


## MyCNC Setup Examples

**NOTE:** The myCNC team recommends utilizing the examples provided in this manual (as well as other manuals in this documentation) as a starting point for your machine setup. When possible (and applicable), it is recommended to keep changes to a minimum. In general, using these examples as the basis for your PLCs/macro commands allows for an easier setup process.


### How to set up Axes and Pulses per Unit

Video tutorial:

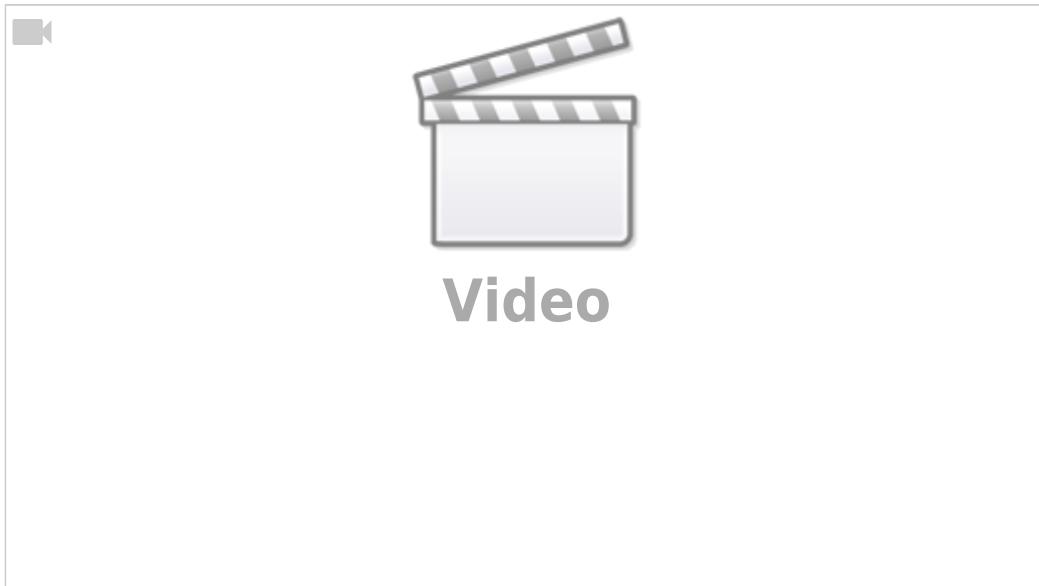

During the initial setup, the axes on your machine (X, Y, Z, A, etc) may be plugged differently from the desired software configuration. In order to assign the correct motor to the axis in the myCNC software:


1. Go to **CNC Settings > Axes/Motors**
2. Navigate to **Motor Outputs Configuration**
3. Assign the connected motors to the needed axes.

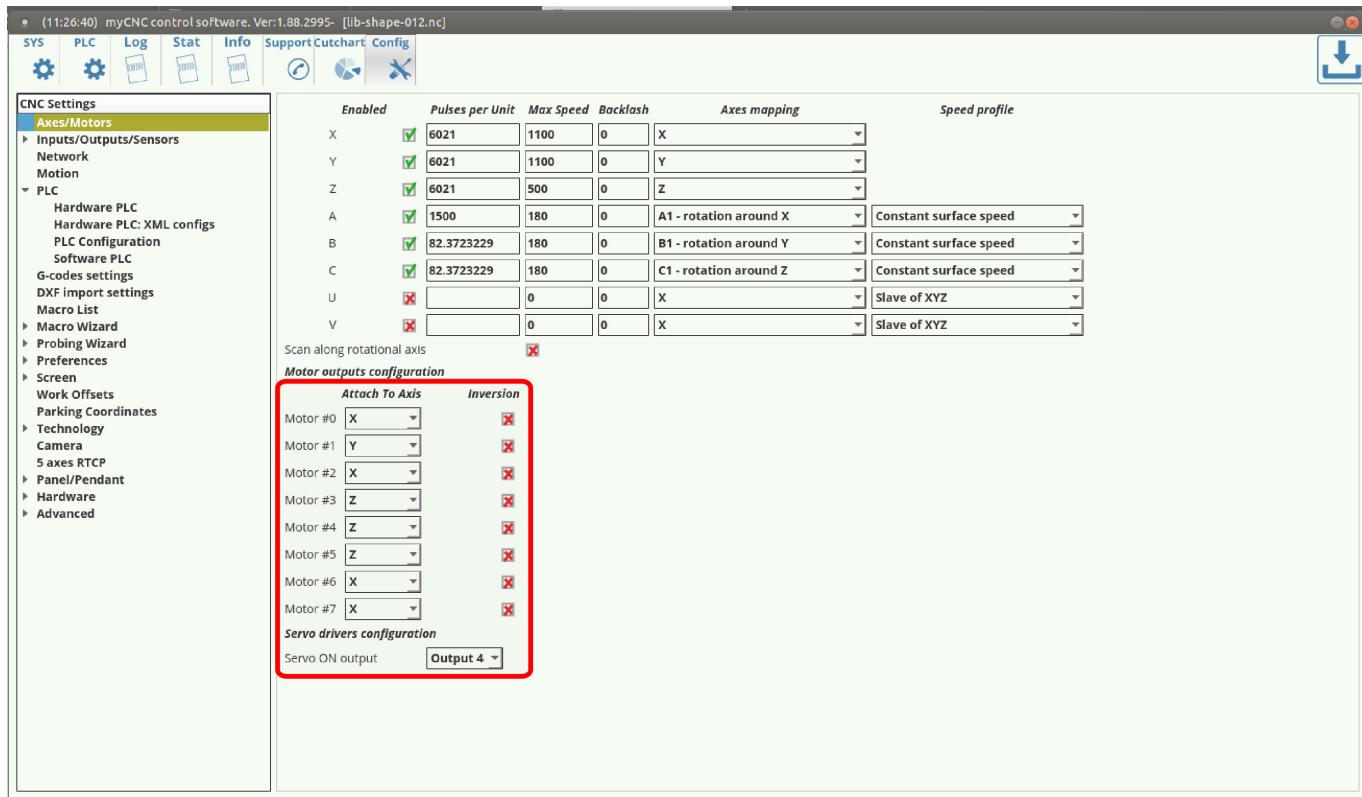

In the same window, the general calibration for the pulses per unit can be performed. This is done in order to calibrate the software readings of the machine (how much the machine “thinks” it has moved) versus the actual physical movements of the machine (how much it has actually moved). To do that:

1. Physically record the position of the spindle/knife/sensor/etc on the machine with a ruler, caliper, camera attached to the machine arm, etc.


2. In the myCNC software, move the machine a set distance (for example, 50 mm).

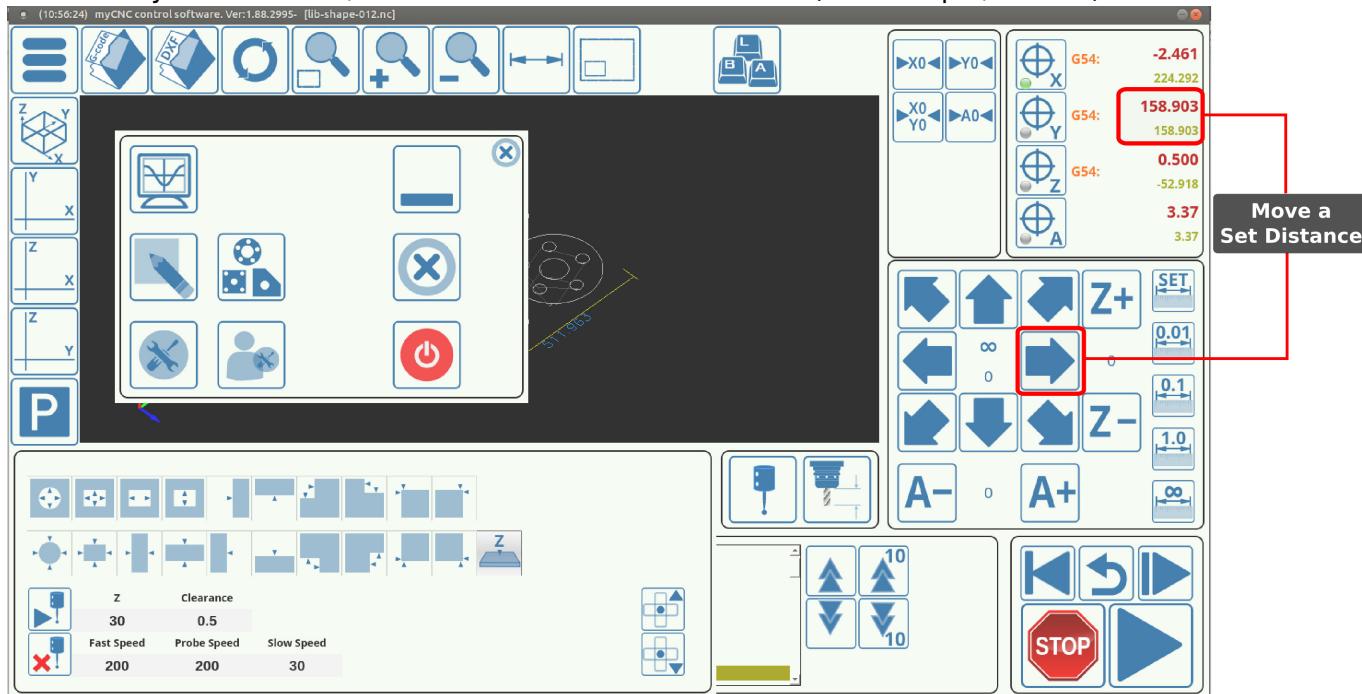

3. Measure the new physical position of the machine and record the distance actually physically traveled.


4. Divide the actual distance by the software distance (for example, 25 mm actually traveled divided by 50 mm that the software recorded)

5. Divide the number of **Pulses per Unit** from the myCNC software CNC Settings > Axes/Motors window by the coefficient from step #4.

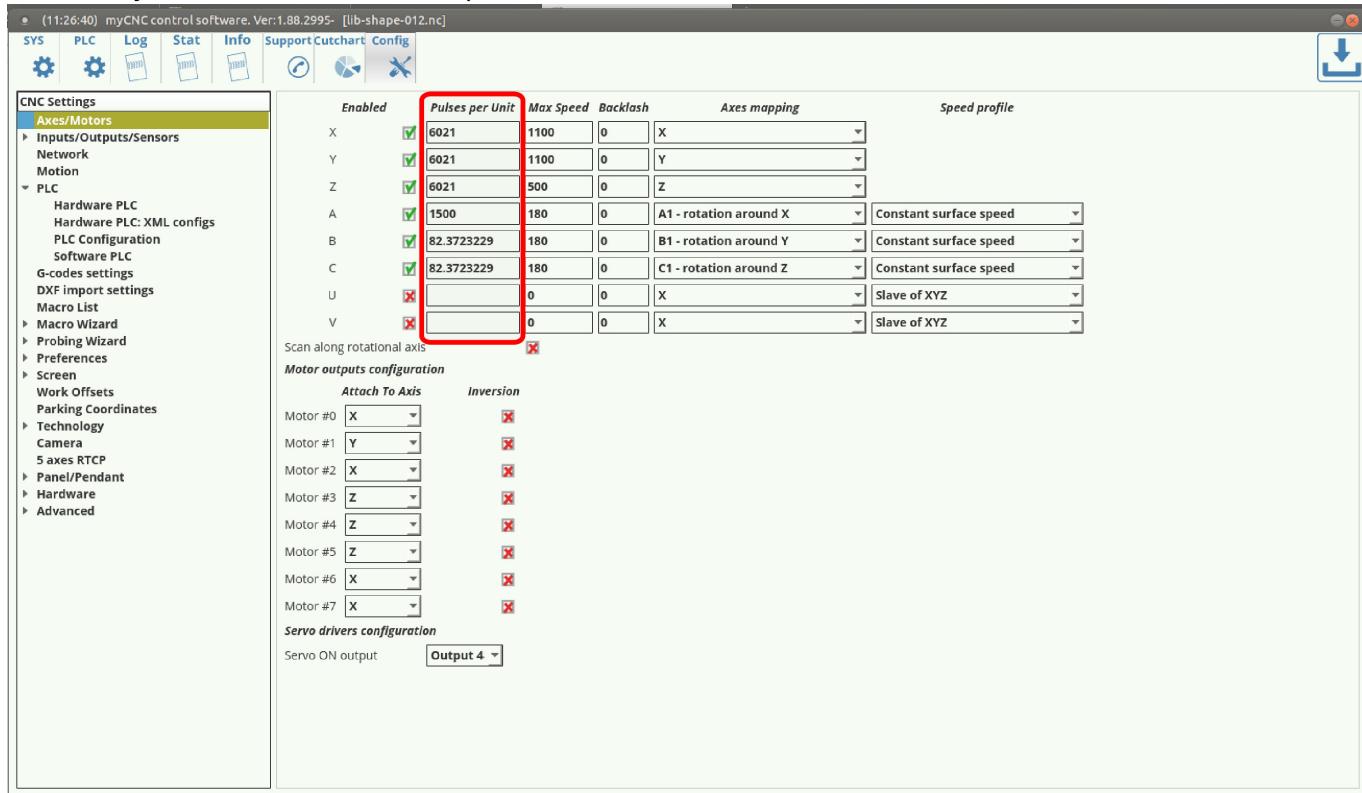

6. Input the new number of pulses per unit into the software.

If the new number of pulses per unit is brought up too high without changing the maximum motor speed, the motors will start making jerking movements when moved. This is due to keeping the **Max Speed** the same. In order to eliminate the jerking movements, bring down the **Max Speed** value in CNC Settings > Axes/Motors until the movement is smooth again.

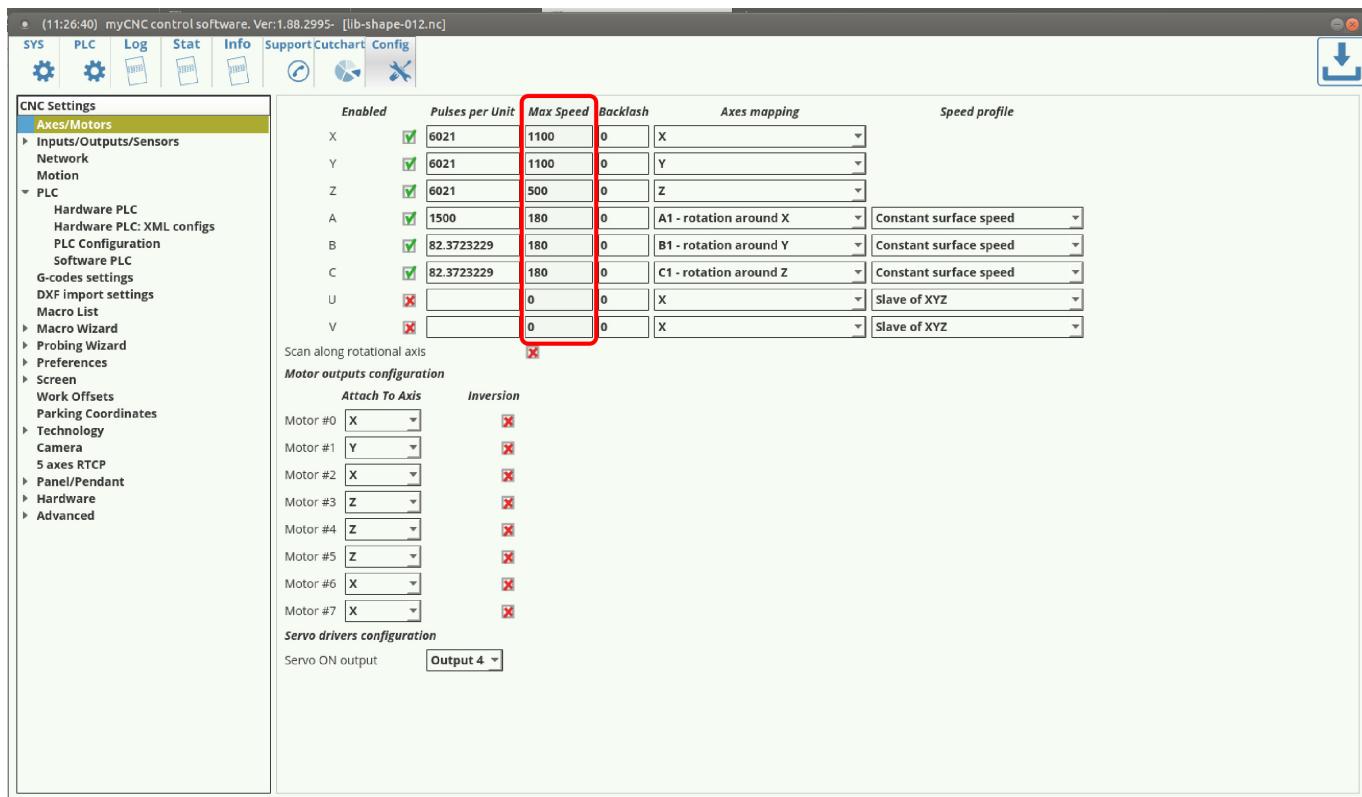

Max Speed is set in units/second (mm/s or inch/s), depending on what units you have chosen in your G-codes settings.

- NOTE: Overspeed acts in a manner similar to CPU overclocking. Motion acceleration is increased together with motion speed when the overspeed is increased. Since toolpath planner does not have access to "Overspeed" value, a significant increase in Overspeed value up from 100% may cause issues, especially for analog servo control. Overspeed should be limited to 100% if you need to be sure the machine does not exceed "Max Speed".*

7. Set the Backlash in units (mm/inch) for each axis. Backlash is the value that allows for some unexpected play in the machine due to clearance or looseness of mechanical parts. When the controller sends a movement command to the motor, the motor may turn briefly before any actual axis movement begins. That turn is defined as backlash, and can be accounted for in this setting.

## How to set up Tangential Knife Cutting

MyCNC control has built-in tangential knife control

Tangential knife control is activated by writing “1” to Global Variable #7005 (GVAR\_TANGENTKNIFE\_ENABLE)

If Tangential control is activated, 2D tool path programming is enough to make tangential knife cutting. myCNC control software automatically

- Calculates the angle of next motion;
- Lifts up the knife to safe height;
- Rotate knife accordingly next XY motion direction;
- Moves down knife on working height.


## How to set up a Probing Wizard in Mill profile

In order to properly set up a probe system on a mill profile from scratch on your machine (especially if the software has not, for any reason, been updated to its latest version) please consult the [QuickStart manual for the probe sensor setup](#):

## How to set up a Lathe/Turning machine


### Lathe/Turning Set up tips

1. Select Basic profile as “Lathe” in **Cfg - Preferences - Common** dialog

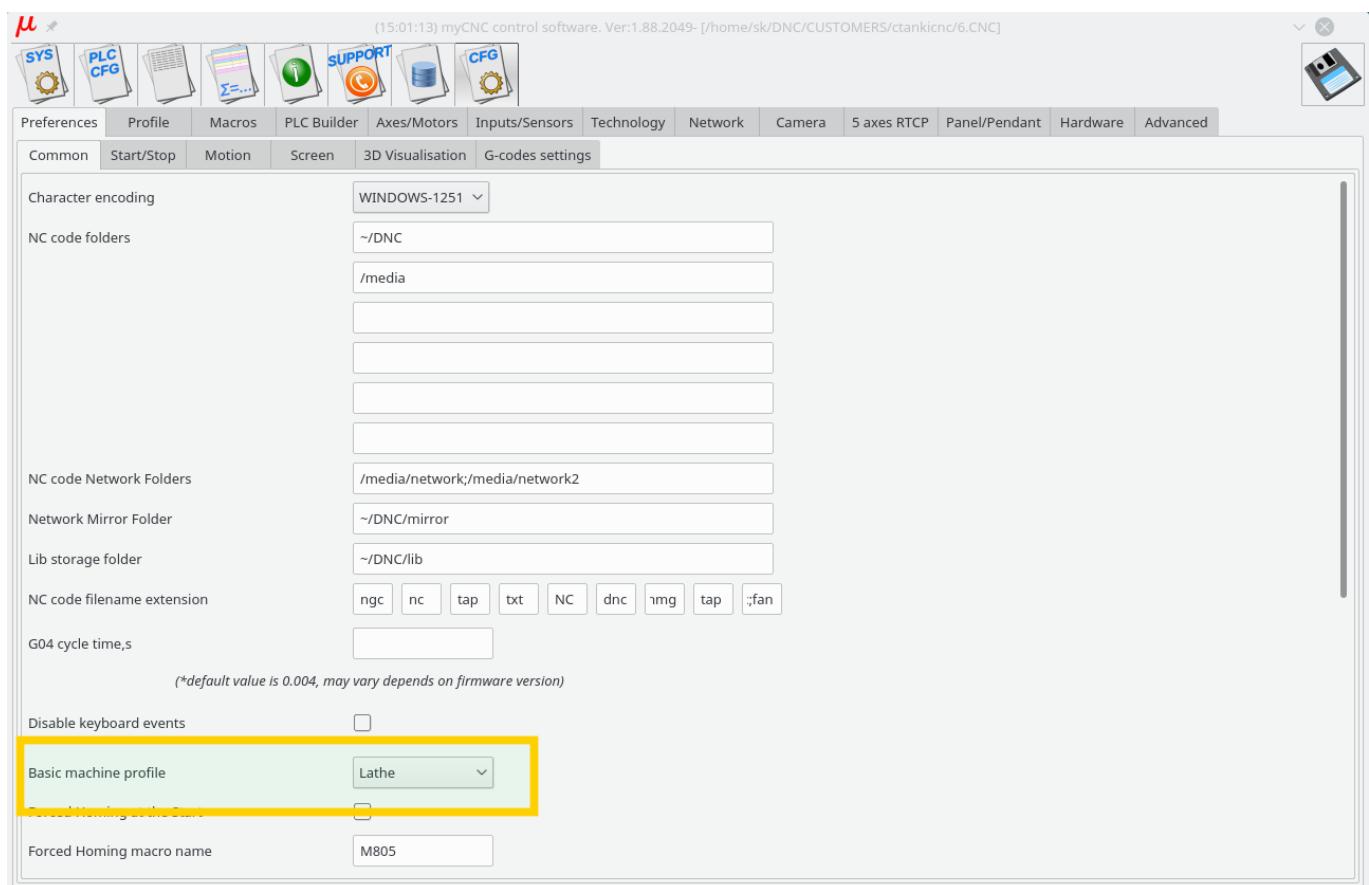


2. Select “Lathe Visualisation” in **Cfg - Preferences - 3D visualisation** configuration dialog


3. Select axes **X, Z** for visualisation and deselect the rest axes.

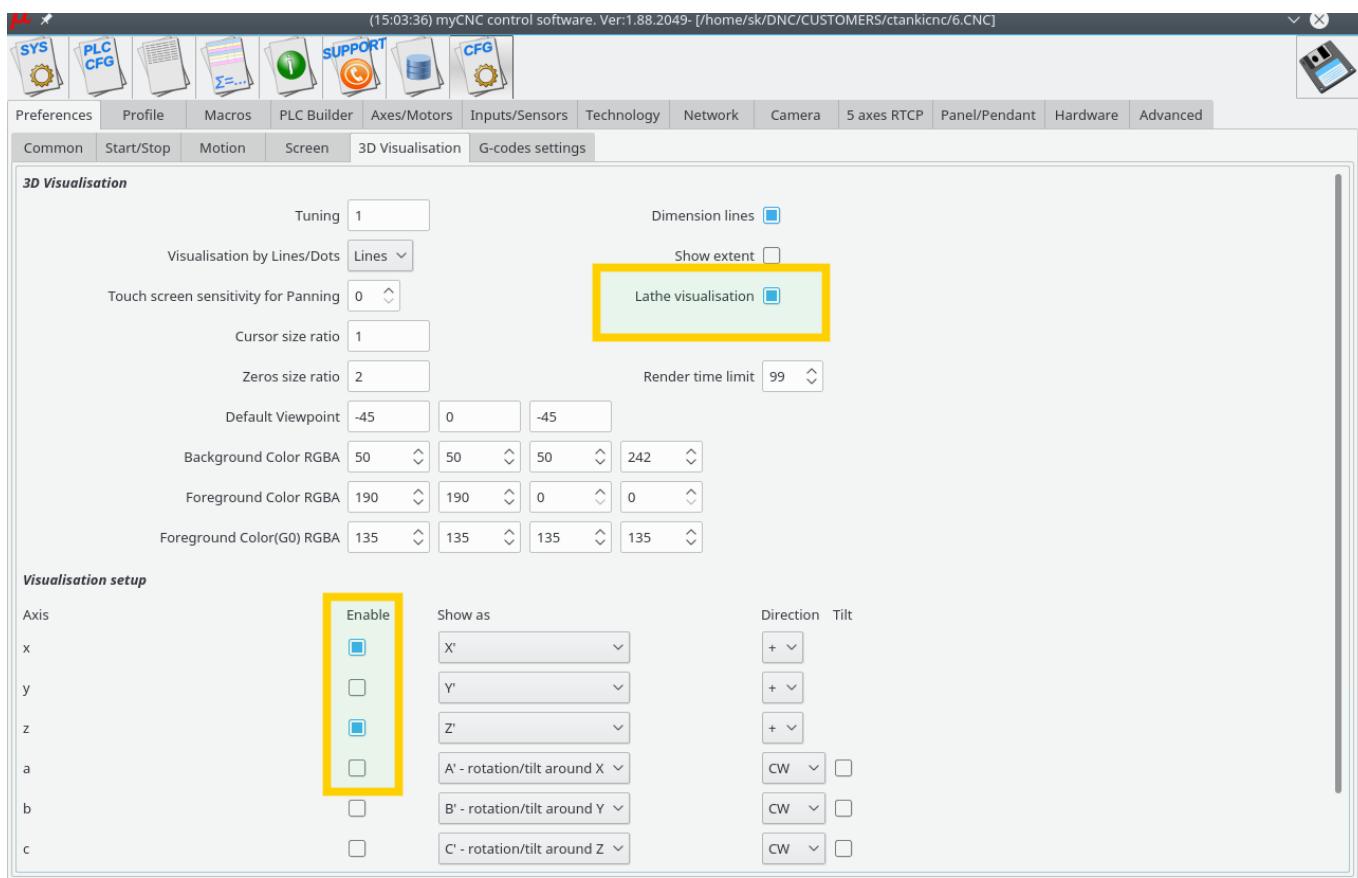

#### 4. Check G-code settings related to Lathe operations in **Cfg - Preferences - G-codes settings** configuration dialog

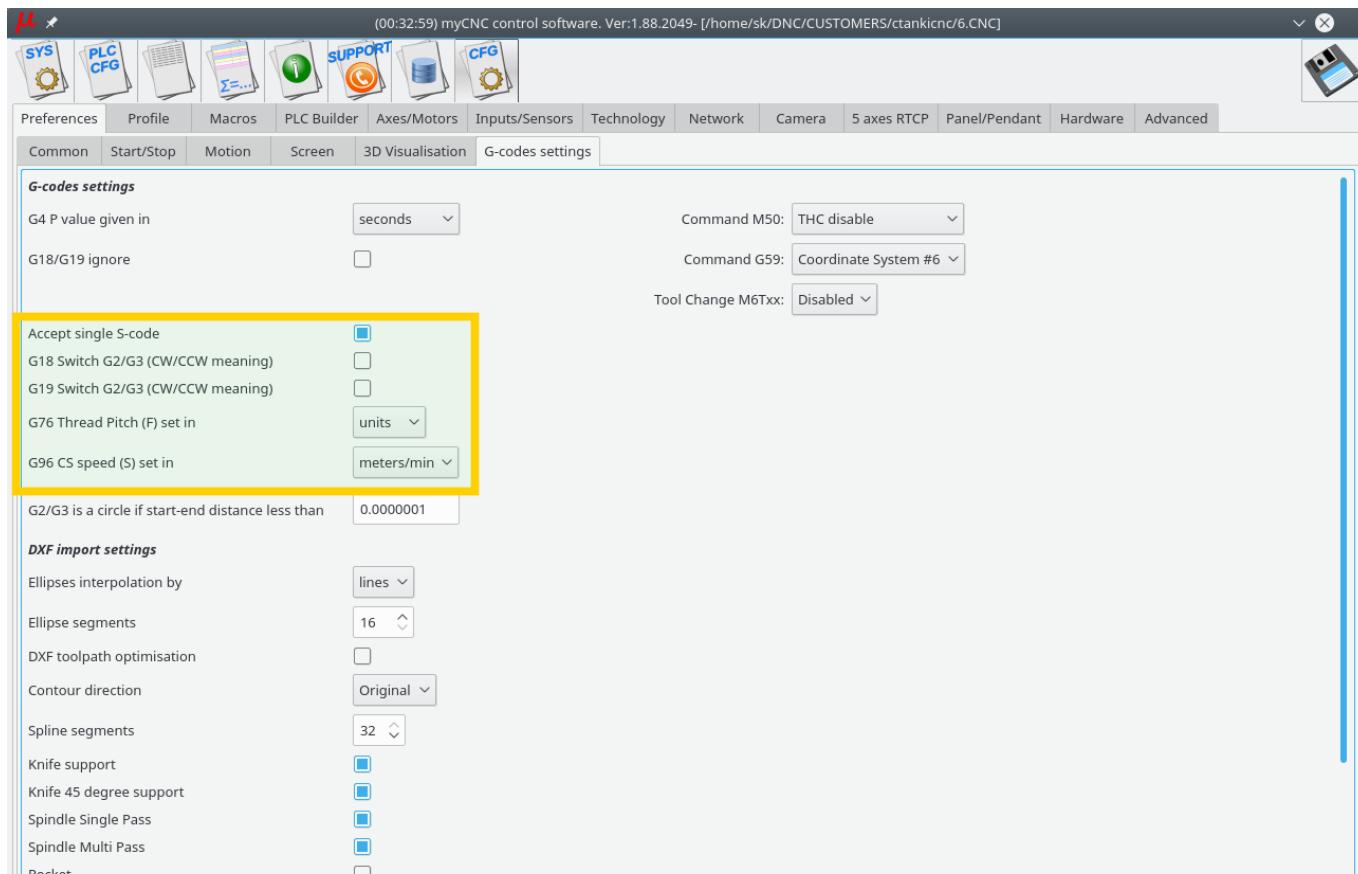

#### 5. Goto **Cfg - Technology - Lathe** configuration dialog and setup appropriate settings

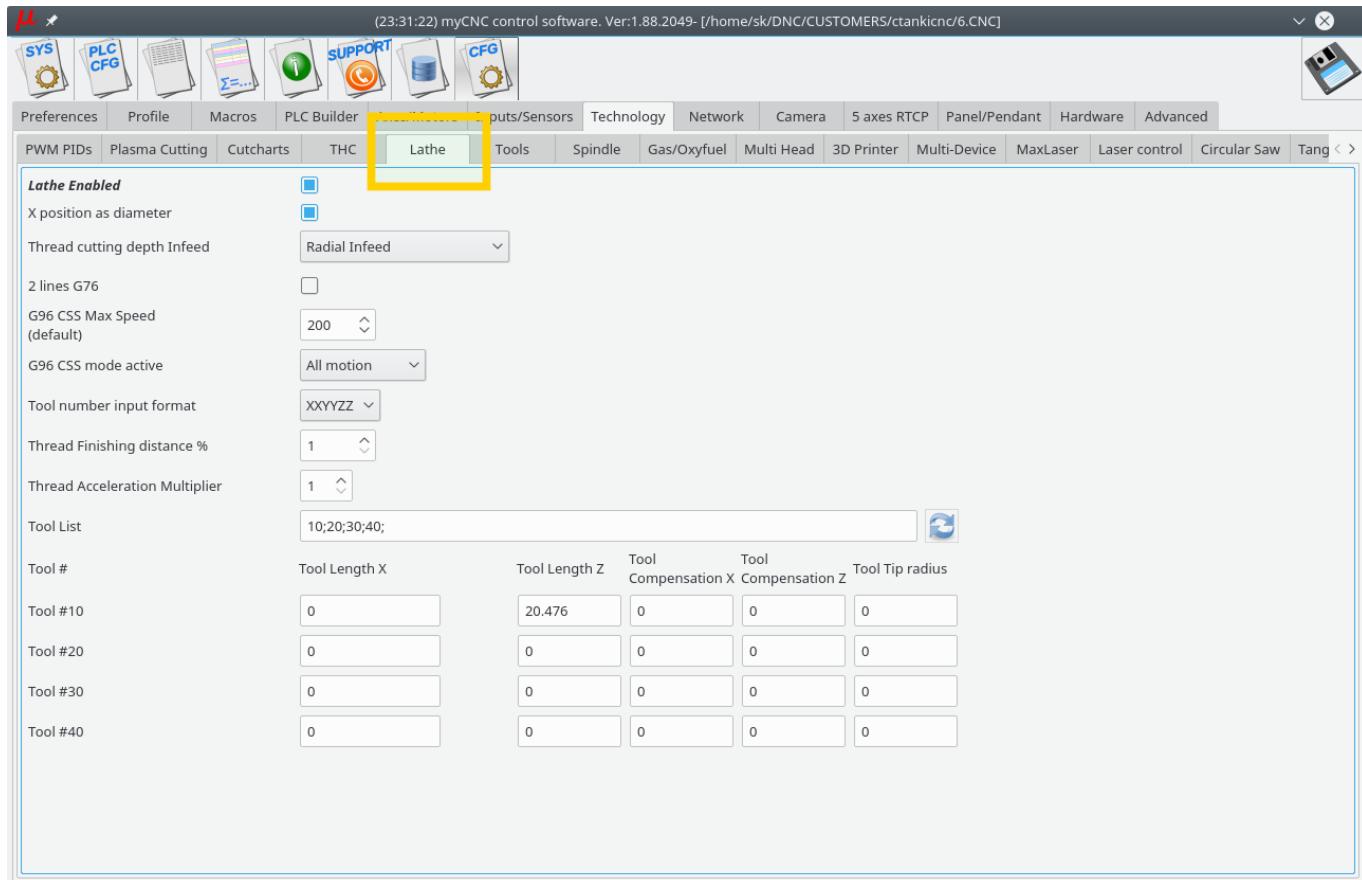

## How to set up a Multi-Tool router

We will put here some process of setup multi-tool router. The router has -

- 2x motors on X axes.
- 2x separate spindles installed on separate Z heads.
- Tangential knife head


1. Inputs/Outputs assignment described on "pins.h" includes the file in **Hardware PLC Builder** area -

### pins.h

```
//input/output definitions
//inputs
#define INPUT_HOME_X_MASTER    0
#define INPUT_HOME_X_SLAVE     1
#define INPUT_HOME_Y            2
#define INPUT_HOME_Z1           3
#define INPUT_HOME_Z2           4
#define INPUT_HOME_KNIFE         5
#define INPUT_E_STOP             7

//Outputs
#define OUTPUT_SPINDLE          0
#define OUTPUT_VAC_POWER         1
#define OUTPUT_VAC_DOWN          2
```

```
#define OUTPUT_HOMING      5
#define OUTPUT_KNIFE        6
```

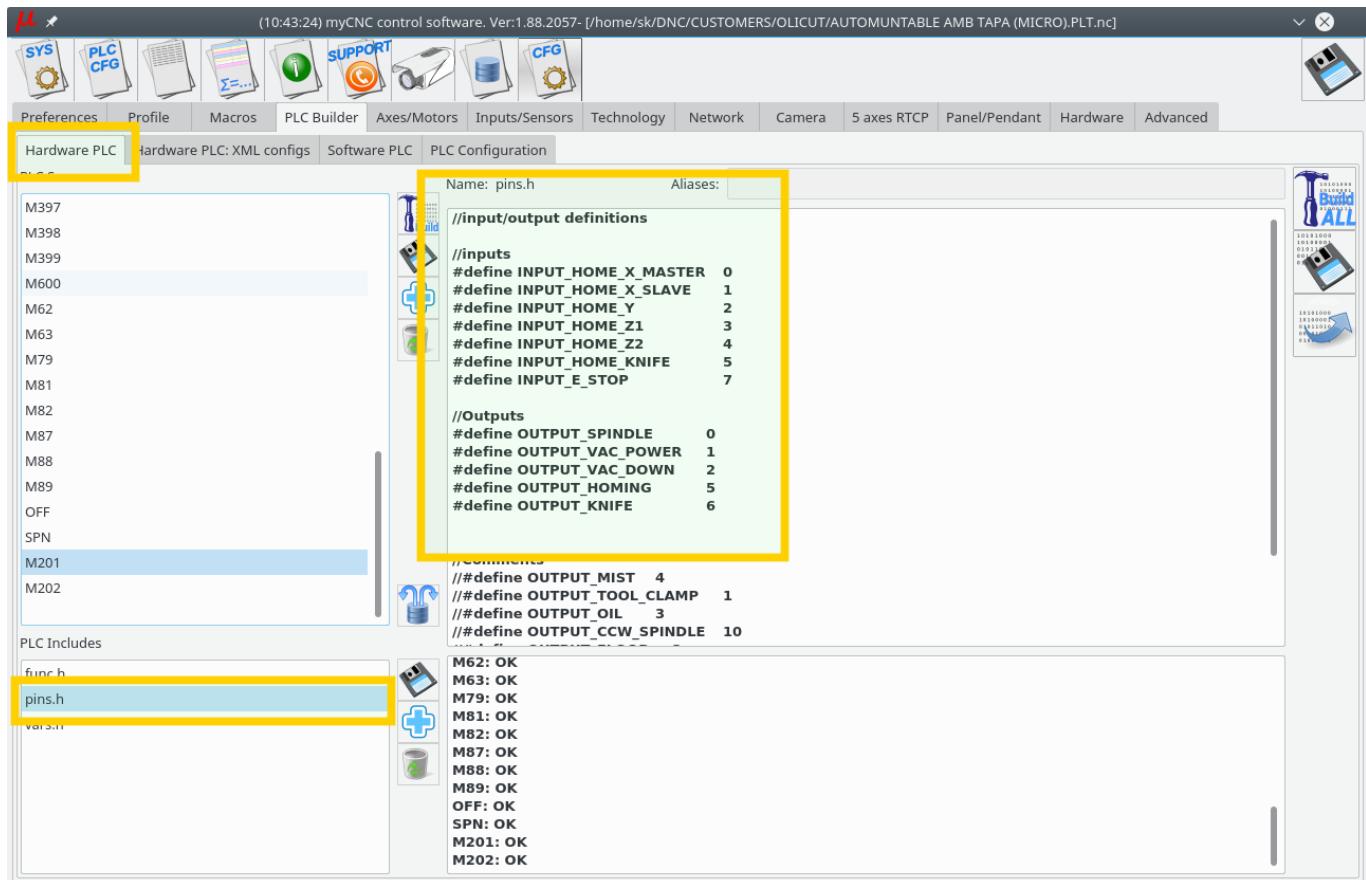

## 2. How to switch between spindles (Z1/Z2) heads.

**Axis pulse-dir signal** can be connected/disconnected from **Motor output** by writing to CNC registers 0x70...0x75 (112...117)

- 0x70 (112) - Motor output #0
- 0x71 (113) - Motor output #1
- 0x72 (114) - Motor output #2
- 0x73 (115) - Motor output #3
- 0x74 (116) - Motor output #4
- 0x75 (117) - Motor output #5

Low 4 bits (0..3) of the writing value represent Axis to connect -

- 0 - X
- 1 - Y
- 2 - Z
- 3 - A
- 4 - B
- 5 - C
- 15 - disconnected

pulse-dir Direction will be changed (**DIR** signal inverted) if Bit #4 is set.

This way we add PLC procedures M201 and M202 to switch Z axis between Motor outputs #3 and #4

### M201.plc

```
#include vars.h
main()
{
    parameter=15;      //OFF
    command=112+3;    //channel 3
    message=PLCCMD_SET_CNC_VAR;
    timer=2;do{timer--;}while(timer>0);

    parameter=2+16;    //Attach to Z
    command=112+4;    //channel 4 turning off
    message=PLCCMD_SET_CNC_VAR;
    timer=2;do{timer--;}while(timer>0);


    exit(99);
};
```

### M202.plc

```
#include vars.h
main()
{
    parameter=15;      //OFF
    command=112+4;    //channel 4
    message=PLCCMD_SET_CNC_VAR;
    timer=2;do{timer--;}while(timer>0);

    parameter=2+16;   //Attach to Z
    command=112+3;    //channel 3
    message=PLCCMD_SET_CNC_VAR;
    timer=2;do{timer--;}while(timer>0);

    exit(99);
};
```

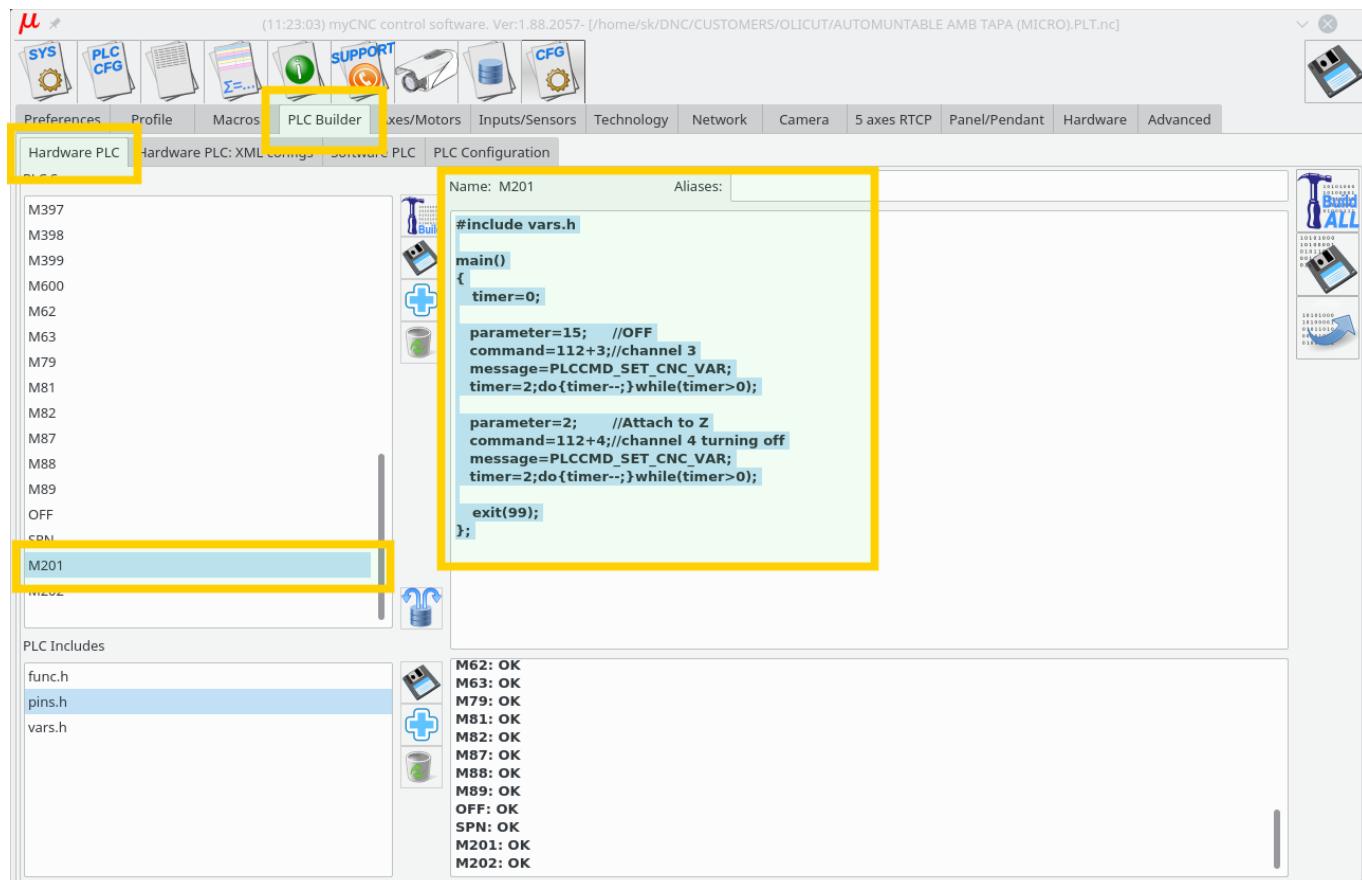

3. Homing for Z1, Z2 axes can be configured in Macro Wizard. **M133** macro is usually used for **Homing Z** procedure. We will use macro names M1331 and M1332 for 2 homing procedures for every Z axis.

### M1331

```

M201 (Turn ON Z1 axis, OFF Z2 axis)
G10 L80 P5521 Q1
G10 L80 P5525 Q1
M88 L0 P3 (Soft stop when sensor triggered)
G91 G0 Z 200.0000 F 600.00
G04 P0.1
M89 L1 P3 (Quick stop when sensor triggered)
G91 G0 Z -200.0000 F 30.00
G04 P0.1
G91 G0 Z 1.0000 F 500.00
G90 G10L70 P0 Z #5453
G10 L80 P5521 Q0
G10 L80 P5525 Q0
G10 L80 P7393 Q0 (Homing Flag)

```

### M1332

```


M202 (Turn OFF Z1 axis, ON Z2 axis)
G10 L80 P5521 Q1
G10 L80 P5525 Q1

```

```

M88 L0 P4(Soft stop when sensor triggered)
G91 G0 Z 200.0000 F 600.00
G04 P0.1
M89 L1 P4(Quick stop when sensor triggered)
G91 G0 Z -200.0000 F 30.00
G04 P0.1
G91 G0 Z 1.0000 F 500.00
G90 G10L70 P0 Z #5453
G10 L80 P5521 Q0
G10 L80 P5525 Q0
G10 L80 P7393 Q0 (Homing Flag)

```

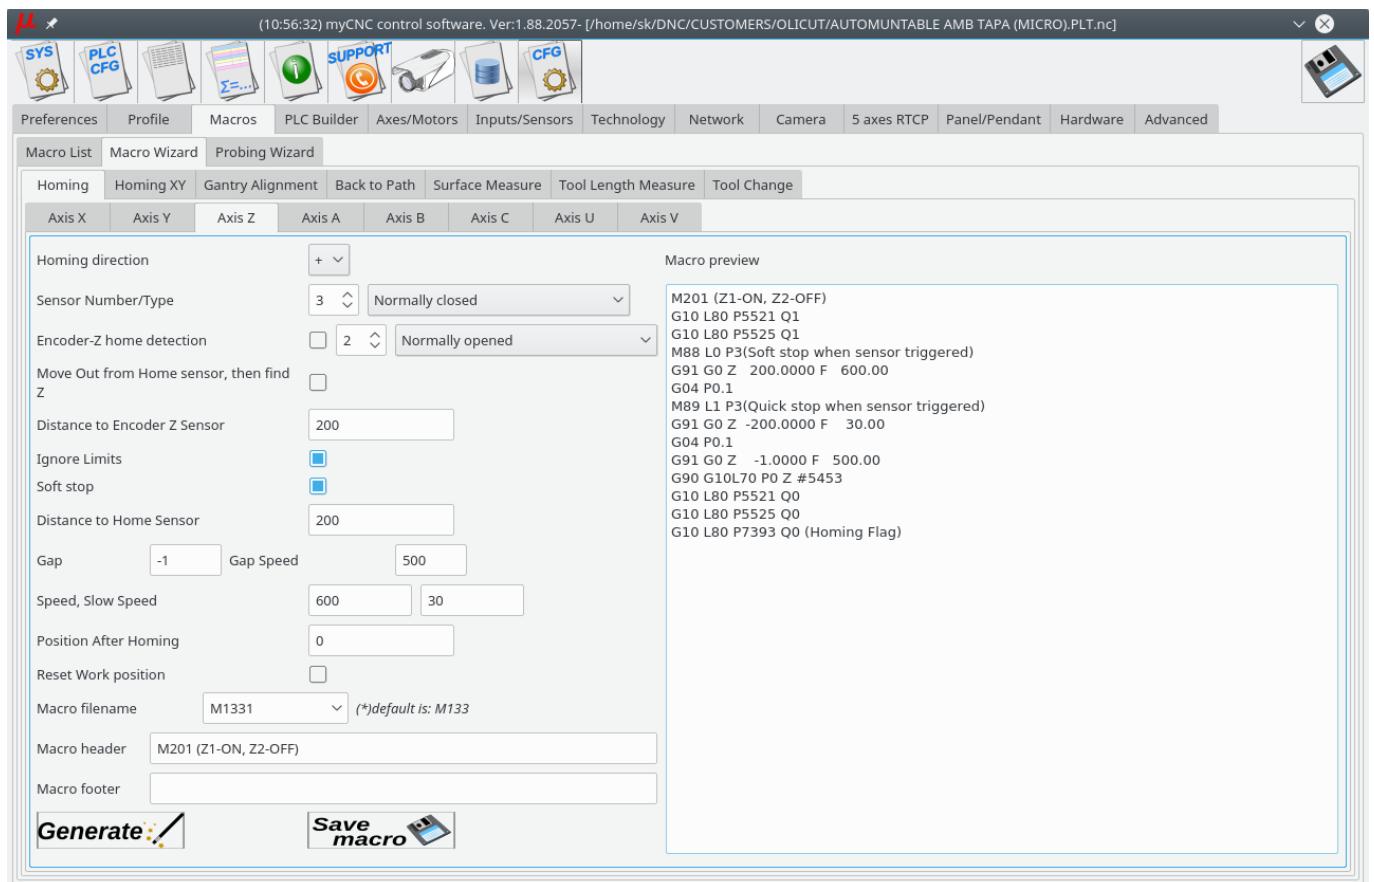

4. **M138** macro is used for **Home-All** procedure. It should be fixed to support Z1, Z2, tangential knife homing and **OUTPUT\_HOMING** output described in “pins.h”

## M138

**M62P5 (OUTPUT HOMING ON)**

**M135 (C-knife)**


**M1331 (Z1)**

**M1332 (Z2)**

**M132 (Y)**

**M131 (X)**

## M63P5 (OUTPUT HOMING OFF)

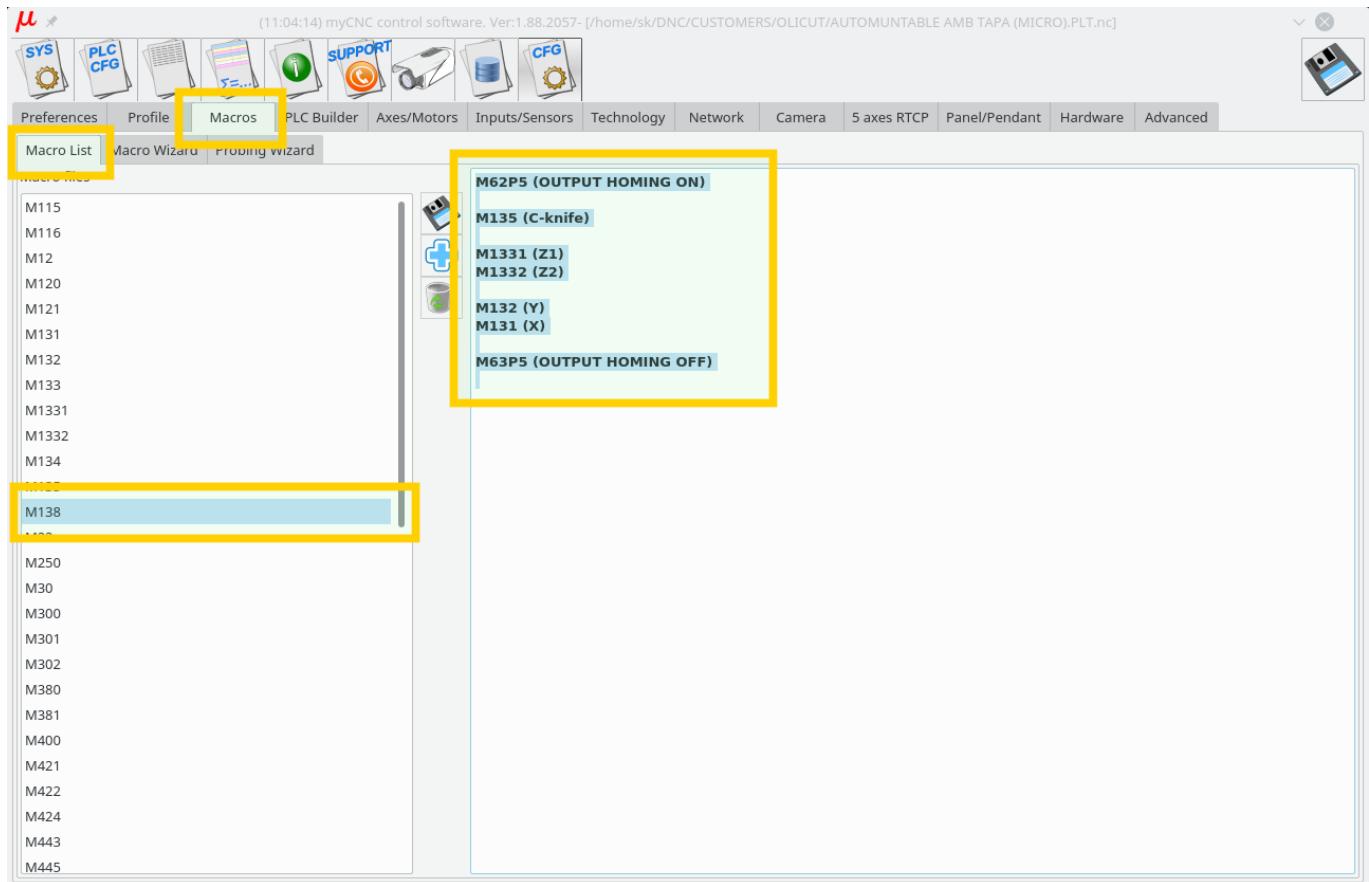

## 5. M6 - Tool Change macro for multitool configuration.

### M6

```
M600 P#5409

if [ #5409 NE 1 ] 100
M150
GOTO 1000

N100
if [ #5409 NE 2 ] 200
M151
JUMP 1000

N200
if [ #5409 EQ 3 ] 300
G10 L80 P7005 Q0
JUMP 1000

N50
G10 L80 P7005 Q1
```

```
N300
N1000
G10 L81 P5400 Q5409      (set current tool number)
```

## How to set up a Multi-Tool Tangential Cutter



*Section under construction*

For tangential cutting, a common scenario is for the system switch between two different motors for both the Z and the C axes (to switch between the tangential knife and the creasing wheel, for instance). Therefore, the system will have:

- X- and Y-axes motors
- Two different motors for the Z-axis (for knife and wheel up-down movement)
- Two different motors for the C-axis (for knife and wheel rotation)

### 1. How to switch between motors:

**Axis pulse-dir signal** can be connected/disconnected from **Motor output** by writing to CNC registers 0x70...0x75 (112...117)

- 0x70 (112) - Motor output #0
- 0x71 (113) - Motor output #1
- 0x72 (114) - Motor output #2
- 0x73 (115) - Motor output #3
- 0x74 (116) - Motor output #4
- 0x75 (117) - Motor output #5

Low 4 bits (0..3) of the writing value represent Axis to connect -

- 0 - X
- 1 - Y
- 2 - Z
- 3 - A
- 4 - B
- 5 - C
- 15 - disconnected

pulse-dir Direction will be changed (**DIR** signal inverted) if Bit #4 is set.

This way we add PLC procedures M201 and M202 to switch Z axis between Motor outputs #3 and #4

### M201.plc

```
#include vars.h
main()
{
```

```

parameter=15; //OFF
command=112+2; //motor output #2
message=PLCCMD_SET_CNC_VAR;
timer=2;do{timer--;}while(timer>0);

parameter=2+16; //Attach to Z-axis, "16" is axis inversion
command=112+3; //motor output #3
message=PLCCMD_SET_CNC_VAR;
timer=2;do{timer--;}while(timer>0);

parameter=15; //OFF
command=112+4; //motor output #4
message=PLCCMD_SET_CNC_VAR;
timer=2;do{timer--;}while(timer>0);

parameter=5; //Attach to C-axis
command=112+5; //motor output #5
message=PLCCMD_SET_CNC_VAR;
timer=2;do{timer--;}while(timer>0);

exit(99);
};

```

## M202.plc

```

#include vars.h
main()
{
    parameter=15; //OFF
    command=112+3; //motor output #3
    message=PLCCMD_SET_CNC_VAR;
    timer=2;do{timer--;}while(timer>0);

    parameter=2+16; //Attach to Z-axis, "16" is axis inversion
    command=112+2; //motor output #2
    message=PLCCMD_SET_CNC_VAR;
    timer=2;do{timer--;}while(timer>0);

    parameter=15; //OFF
    command=112+5; //motor output #5
    message=PLCCMD_SET_CNC_VAR;
    timer=2;do{timer--;}while(timer>0);

    parameter=5; //Attach to C-axis
    command=112+4; //motor output #4
    message=PLCCMD_SET_CNC_VAR;
    timer=2;do{timer--;}while(timer>0);

    exit(99);
}

```

```
};
```

**2.** Homing for Z1, Z2 axes can be configured in Macro Wizard. **M133** macro is usually used for **Homing Z** procedure. We will use macro names M1331 and M1332 for 2 homing procedures for every Z axis.

### M1331

```
M201 (Turn ON Z1 axis, OFF Z2 axis)
G10 L80 P5521 Q1
G10 L80 P5525 Q1
M88 L0 P3 (Soft stop when sensor triggered)
G91 G0 Z 200.0000 F 600.00
G04 P0.1
M89 L1 P3 (Quick stop when sensor triggered)
G91 G0 Z -200.0000 F 30.00
G04 P0.1
G91 G0 Z 1.0000 F 500.00
G90 G10L70 P0 Z #5453
G10 L80 P5521 Q0
G10 L80 P5525 Q0
G10 L80 P7393 Q0 (Homing Flag)
```

### M1332

```
M202 (Turn OFF Z1 axis, ON Z2 axis)
G10 L80 P5521 Q1
G10 L80 P5525 Q1
M88 L0 P4 (Soft stop when sensor triggered)
G91 G0 Z 200.0000 F 600.00
G04 P0.1
M89 L1 P4 (Quick stop when sensor triggered)
G91 G0 Z -200.0000 F 30.00
G04 P0.1
G91 G0 Z 1.0000 F 500.00
G90 G10L70 P0 Z #5453
G10 L80 P5521 Q0
G10 L80 P5525 Q0
G10 L80 P7393 Q0 (Homing Flag)
```

**3.** M6 - Tool Change macro for multitool configuration.

### M6

```
M600 P#5409

if [ #5409 NE 1 ] 100
M150
```

```
GOTO 1000

N100
if [ #5409 NE 2 ] 200
M201
JUMP 1000

N200
if [ #5409 EQ 3 ] 300
M202
JUMP 1000

N50
G10 L80 P7005 Q1

N300

N1000
G10 L81 P5400 Q5409      (set current tool number)
```

## How to setup Homing procedure

Homing is a procedure to find the initial machine position (home position) by using Home sensors. The home procedure is a macro file. The macro filename is absolutely flexible, but we usually use a number of default macro names -

- M131 - Homing for the X axis
- M132 - Homing for the Y axis
- M133 - Homing for the Z axis
- M134 - Homing for A axis
- M135 - Homing for B axis
- M136 - Homing for C axis
- M138 - Homing all the axes (custom macro which does all the axes homing in series)


There are a few ways to send the machine to find homes

- It's possible to configure mandatory homing if CNC control system started and/or an Emergency or Servo drivers alarm event happened.




The red button on the message popup widget should be pressed to send a machine to the home position. The popup message will be hidden when all home flags are ready.


- Home macro procedure can be started from the MDI interface

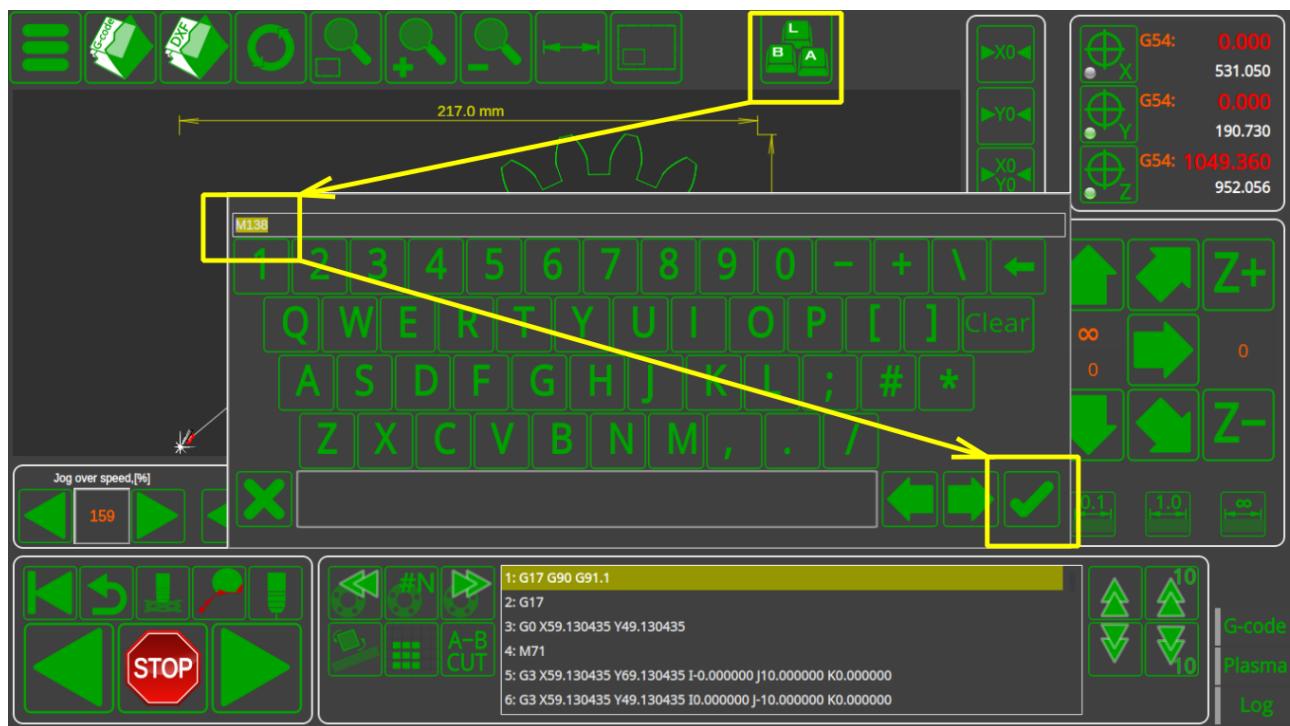

- UI might contain button to send machine home. For example buttons for homing each axis X, Y, Z, A, B, C on diagnose widget

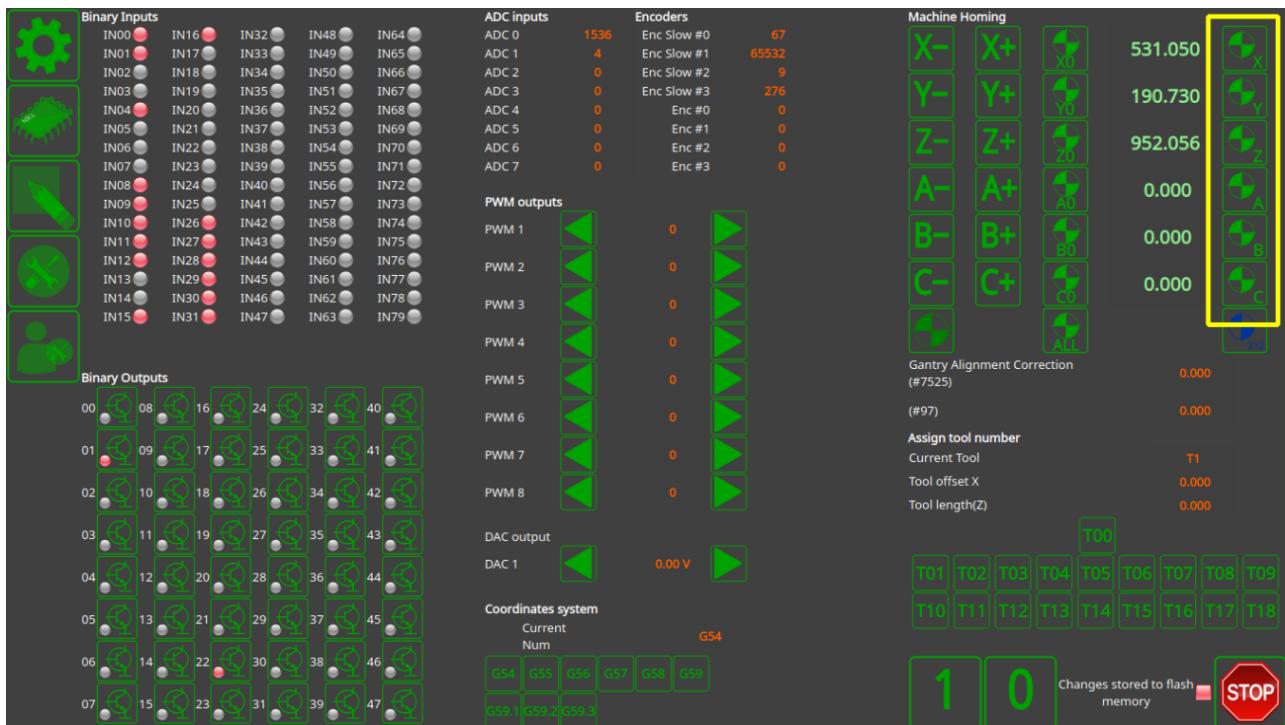


or All the Axes Homing button on the main screen of "1024P-V2" profile

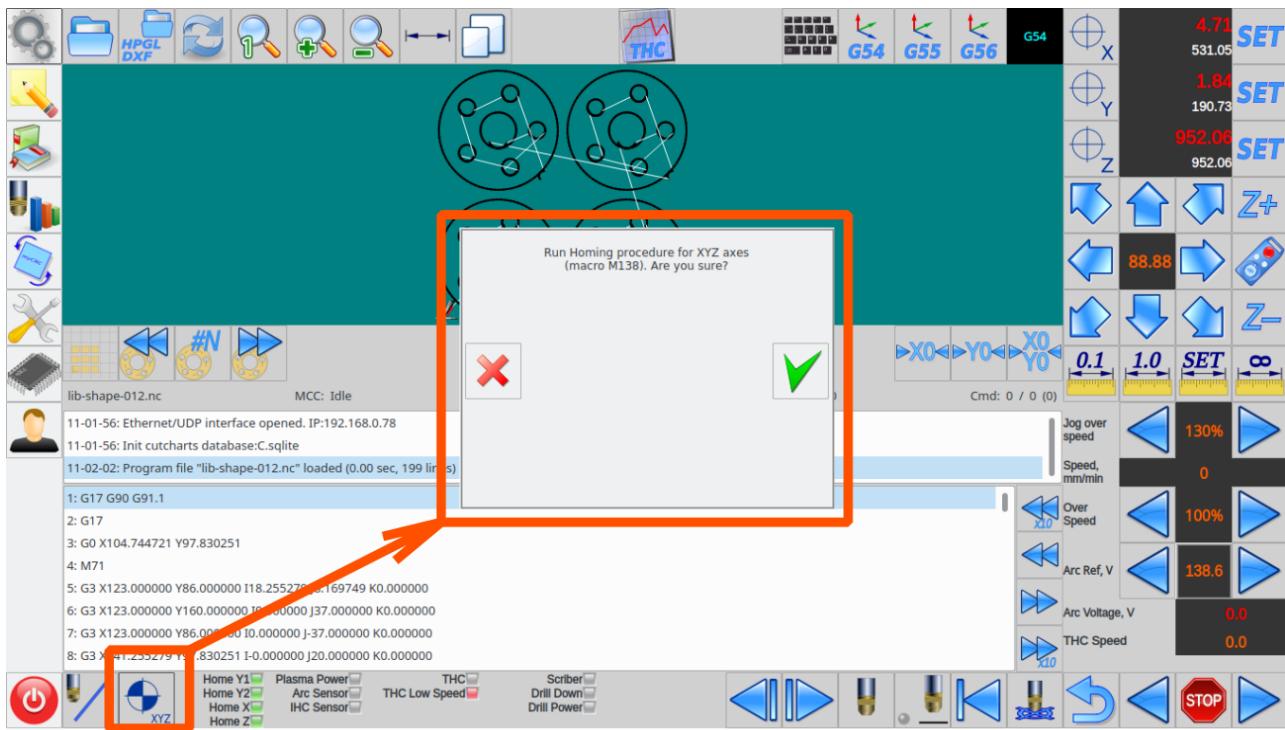


Homing Macro files should be created during machine setup. Macro file can be created

- in "Macro Wizard" conversational dialogs

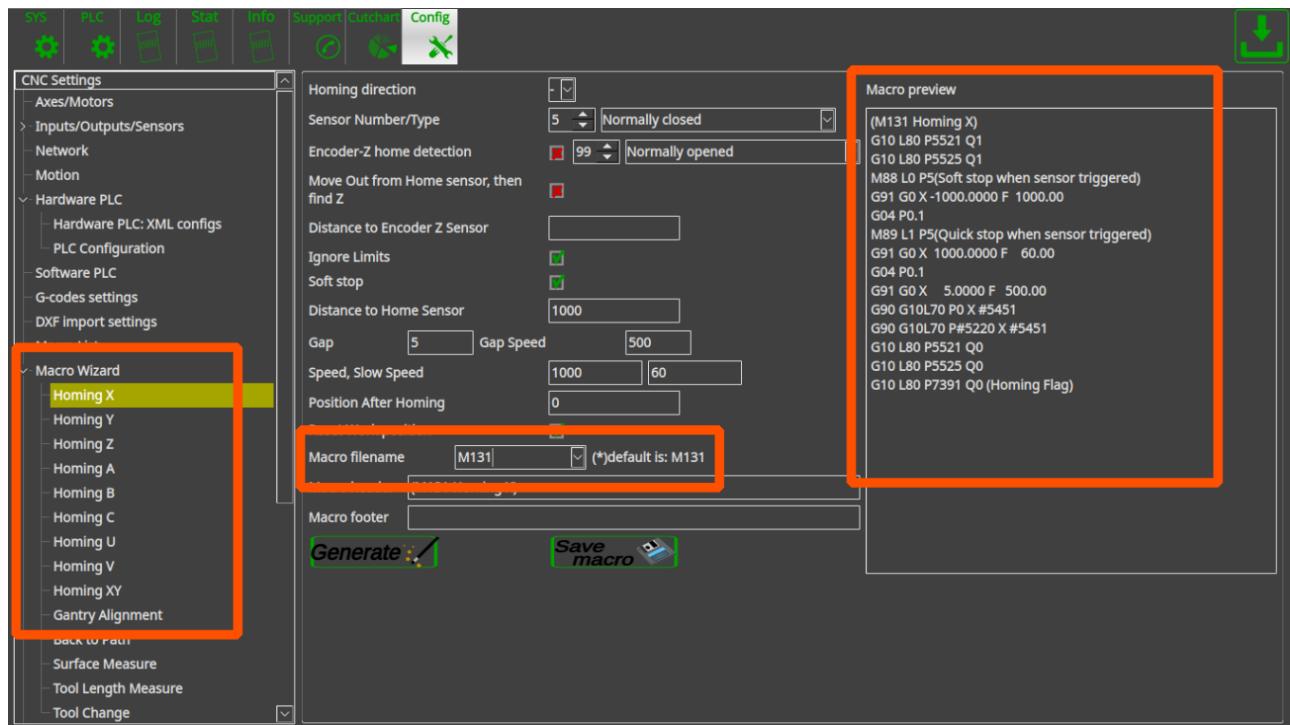

By using the macro wizard you just point homing moving direction, input number used for home sensor, sensor type (normally opened/closed), homing and probing speed, parameters of Encoder Z-label (if used to find precise homing position) and some other parameters. Macro file will be generated on the widget "Macro preview" by pressing "Generate" button. If the macro is ok, the button "Save macro" should be pressed to save macro file on a storage device (HDD, SD card etc). The dialog settings itself might be saved in the configuration file by pressing "Save" button on the top-right corner of the screen.

- manually in "Macro List" widget

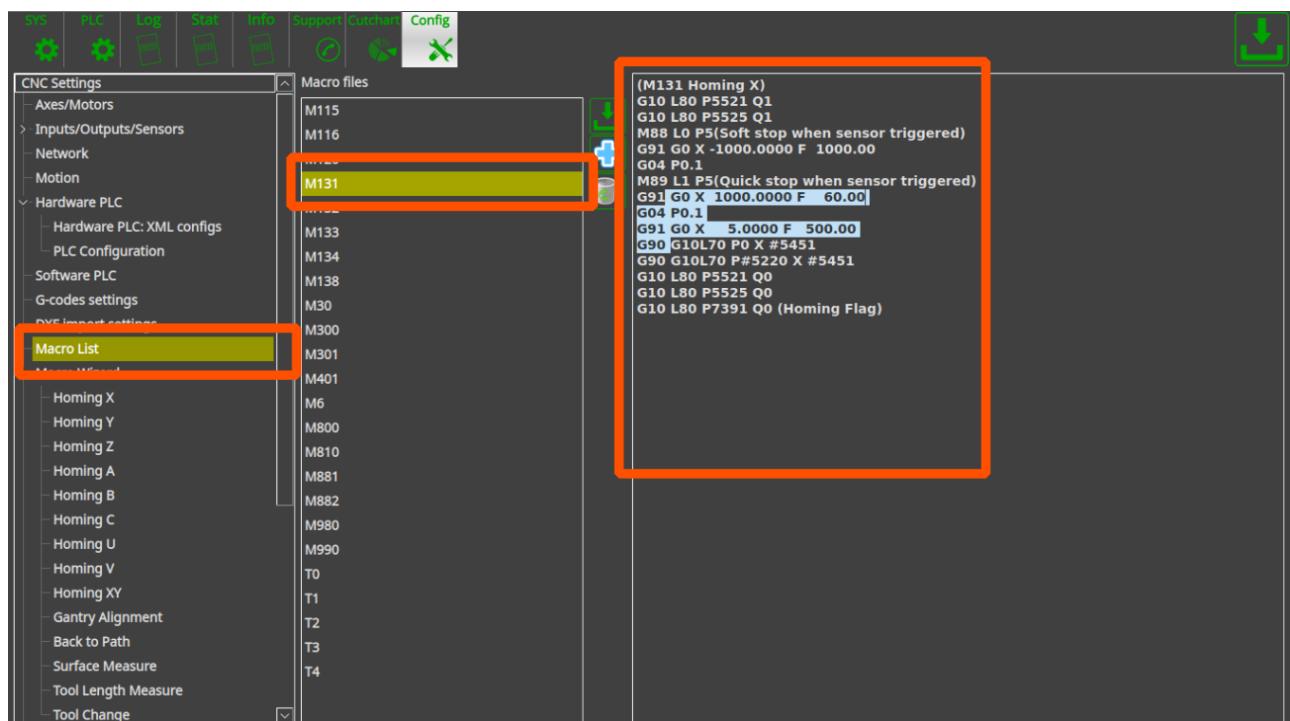


Home-All macro M138 is a simple macro file which runs in series macro files for all axes. For simple 3 axes machine it would be like this

## M138

```
M133
M132
M131
```

Procedure started from Homing Z, then Y and the last is X. Any other sequence can be chosen according to your requirements.

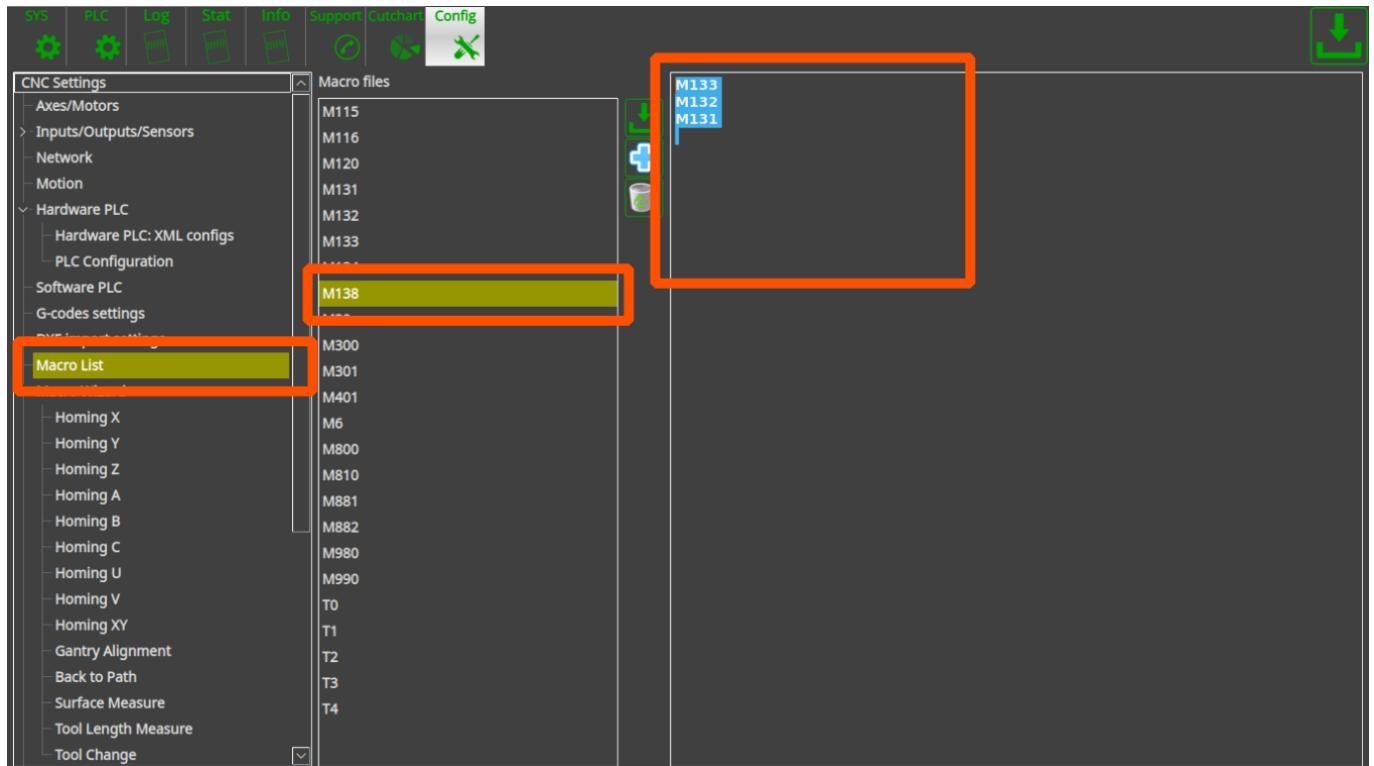

In case Gantry alignment procedure used instead of standard homing procedure, it might have different macro file name to not be mixed-up with standard homing procedure. For example - homing Y is "M132", gantry alignment is "M1321". This is just example, any of macro filename can be chosen. The result of Home-All macro would be

## M138

```
M133
M1321
M131
```

Home-All macro can be very different for more complicated machines with multi-spindles, 5 axes and so on. For example M138 macro for multi-spindle machine with tangential knife.

## M138

```
M62P5 (OUTPUT HOMING ON)
M135 (C-knife)
```

```
M1331 (Homing Z1)
M1332 (Homing Z2)

M132 (Homing Y)
M131 (Homing X)


M63P5 (OUTPUT HOMING OFF)
```

## How to set up Homing Handler

If the machine has stopped unexpectedly, due to things like an emergency stop button press/power failure/etc, it is sometimes necessary to prompt the user to run the Homing procedure again before allowing any further actions to be taken in order to safely calibrate the machine. In order to do that, a software PLC is put in place called the **HOMING\_HANDLER**

The Homing Handler can be set up by using the following instructions:

1. Go to **Settings > Config > PLC > Software PLC** and select **HOMING\_HANDLER**

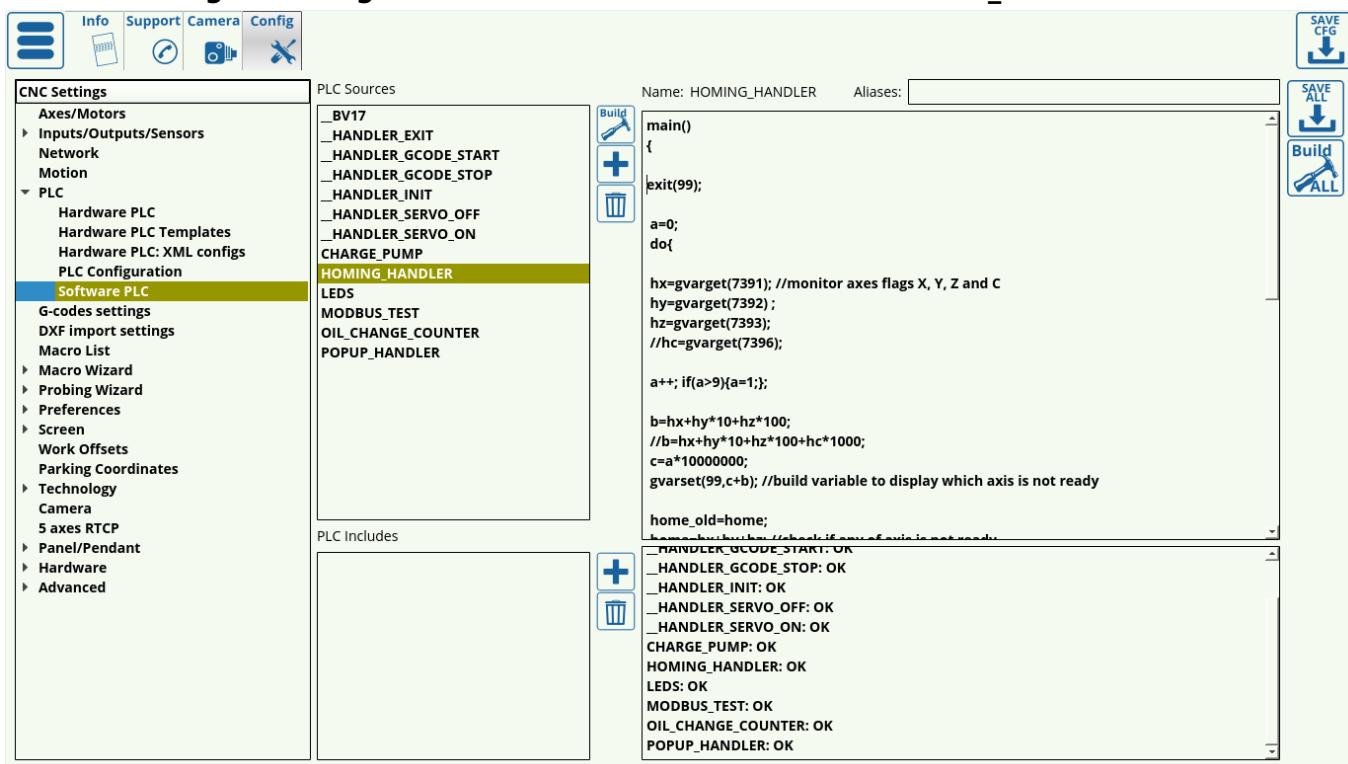

2. In the HOMING\_HANDLER code, put the two forward slashes in front of the **exit(99);** line, commenting it out.

```

CNC Settings
Axes/Motors
Inputs/Outputs/Sensors
Network
Motion
PLC
  Hardware PLC
  Hardware PLC Templates
  Hardware PLC: XML configs
  PLC Configuration
    Software PLC
      G-codes settings
      DXF import settings
      Macro List
      Macro Wizard
      Probing Wizard
      Preferences
      Screen
      Work Offsets
      Parking Coordinates
    Technology
    Camera
    5 axes RTCP
  Panel/Pendant
  Hardware
  Advanced

PLC Sources
Name: HOMING_HANDLER Aliases: [ ]  

main()  

{  

//exit(99);  

a=0;  

do{  

hx=gvarget(7391); //monitor axes flags X, Y, Z and C  

hy=gvarget(7392);  

hz=gvarget(7393);  

//hc=gvarget(7396);  

a++; if(a>9){a=1;}  

b=hx+hy*10+hz*100;  

//b=hx+hy*10+hz*100+hc*1000;  

c=*10000000;  

gvarset(99,c+b); //build variable to display which axis is not ready  

home_old=home;  

HANDLER_GCODE_START: OK  

HANDLER_GCODE_STOP: OK  

HANDLER_INIT: OK  

HANDLER_SERVO_OFF: OK  

HANDLER_SERVO_ON: OK  

CHARGE_PUMP: OK  

HOMING_HANDLER: OK  

LEDS: OK  

MODBUS_TEST: OK  

OIL_CHANGE_COUNTER: OK  

POPUP_HANDLER: OK

```

Note that the axes for which the homing is not required (Axis C in this case) have also been commented out. If only select axes need to be included in the homing procedure after the emergency stop, these can be configured in the code by adding/deleting forward slashes in front of the respective axes' commands.

```

CNC Settings
Axes/Motors
Inputs/Outputs/Sensors
Network
Motion
PLC
  Hardware PLC
  Hardware PLC Templates
  Hardware PLC: XML configs
  PLC Configuration
    Software PLC
      G-codes settings
      DXF import settings
      Macro List
      Macro Wizard
      Probing Wizard
      Preferences
      Screen
      Work Offsets
      Parking Coordinates
    Technology
    Camera
    5 axes RTCP
  Panel/Pendant
  Hardware
  Advanced

PLC Sources
Name: HOMING_HANDLER Aliases: [ ]  

main()  

{  

//exit(99);  

a=0;  

do{  

hx=gvarget(7391); //monitor axes flags X, Y, Z and C  

hy=gvarget(7392);  

hz=gvarget(7393);  

//hc=gvarget(7396);  

a++; if(a>9){a=1;}  

b=hx+hy*10+hz*100;  

//b=hx+hy*10+hz*100+hc*1000;  

c=*10000000;  

gvarset(99,c+b); //build variable to display which axis is not ready  

home_old=home;  

HANDLER_GCODE_START: OK  

HANDLER_GCODE_STOP: OK  

HANDLER_INIT: OK  

HANDLER_SERVO_OFF: OK  

HANDLER_SERVO_ON: OK  

CHARGE_PUMP: OK  

HOMING_HANDLER: OK  

LEDS: OK  

MODBUS_TEST: OK  

OIL_CHANGE_COUNTER: OK  

POPUP_HANDLER: OK

```

At this point, in an emergency stop situation, myCNC will prompt the user to run the homing procedure for the selected axes before any other action is taken after starting the machine back up again.


In order to disable the Homing Handler, add the two forward slashes in front of **exit(99);** again, then Save and reload the application.

## How to setup Dual Axis (Slave X, Slave Y)


Dual axis setup is really simple.

Goto "Axes/Motors" configuration dialog and set the same axis for two motor outputs. They will work together

For example, motor outputs #0 and #1 are used for the same X axis on the picture below.

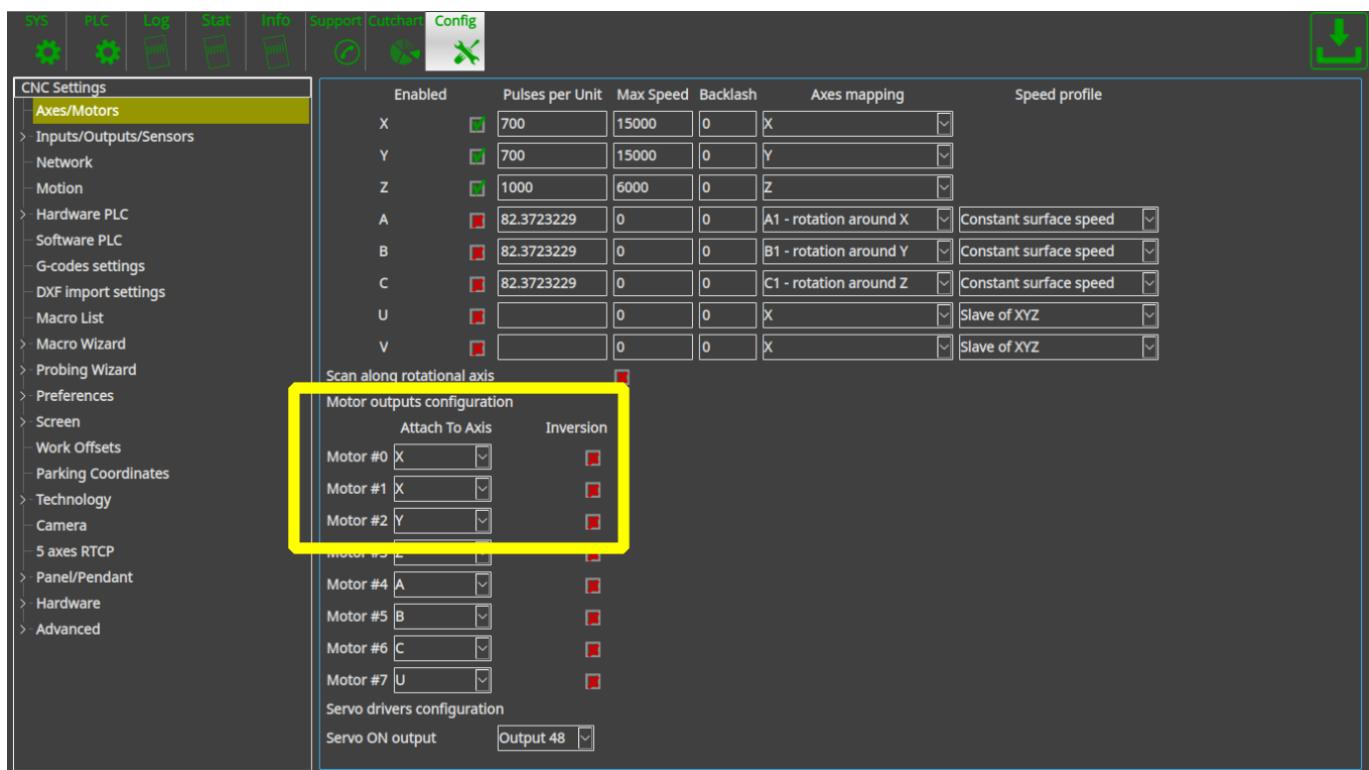


Next picture shows how to attach the Y axis to motor outputs #1, #2.

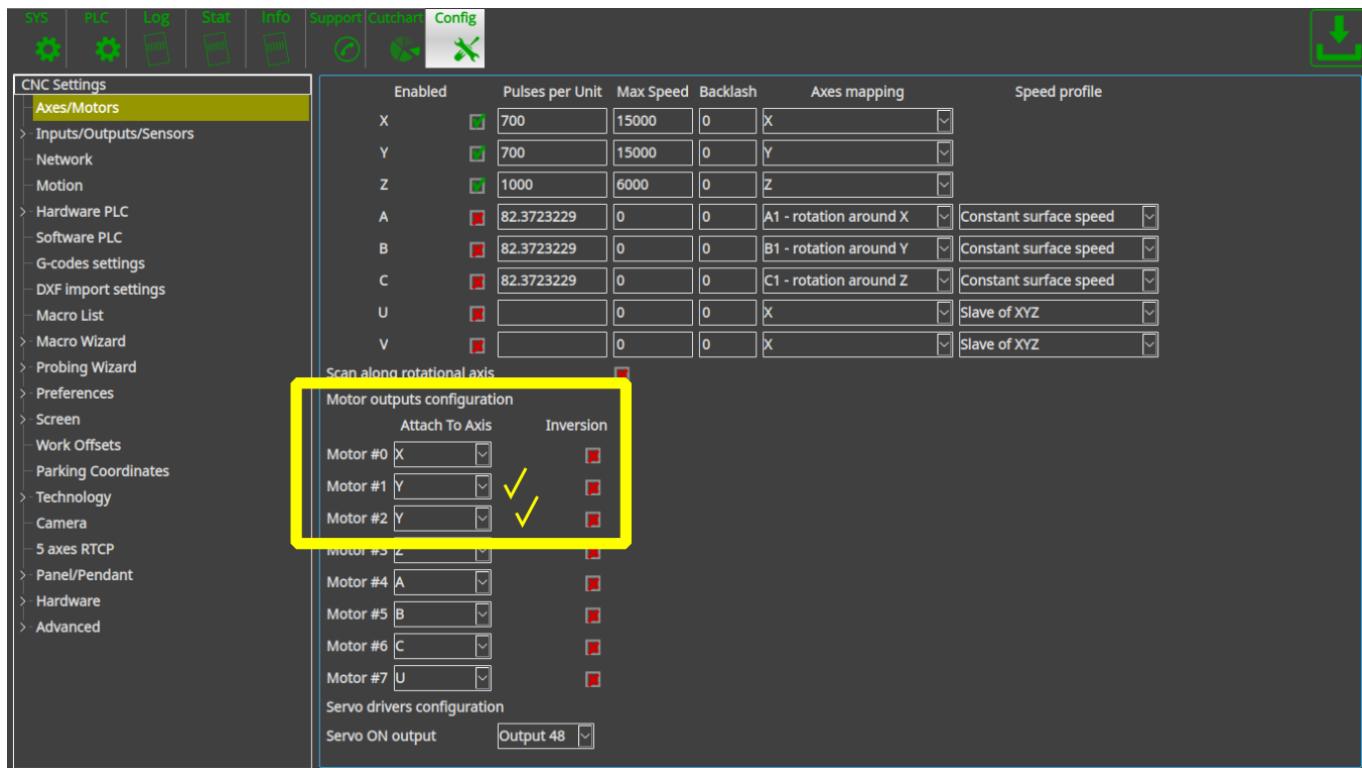


## How to set up two instances of myCNC software on one machine

In order to start two instances of myCNC software on a single board Odroid-C2 computer:


1. Go to your **Home** folder, and in the **View** menu click **Show Hidden Files**

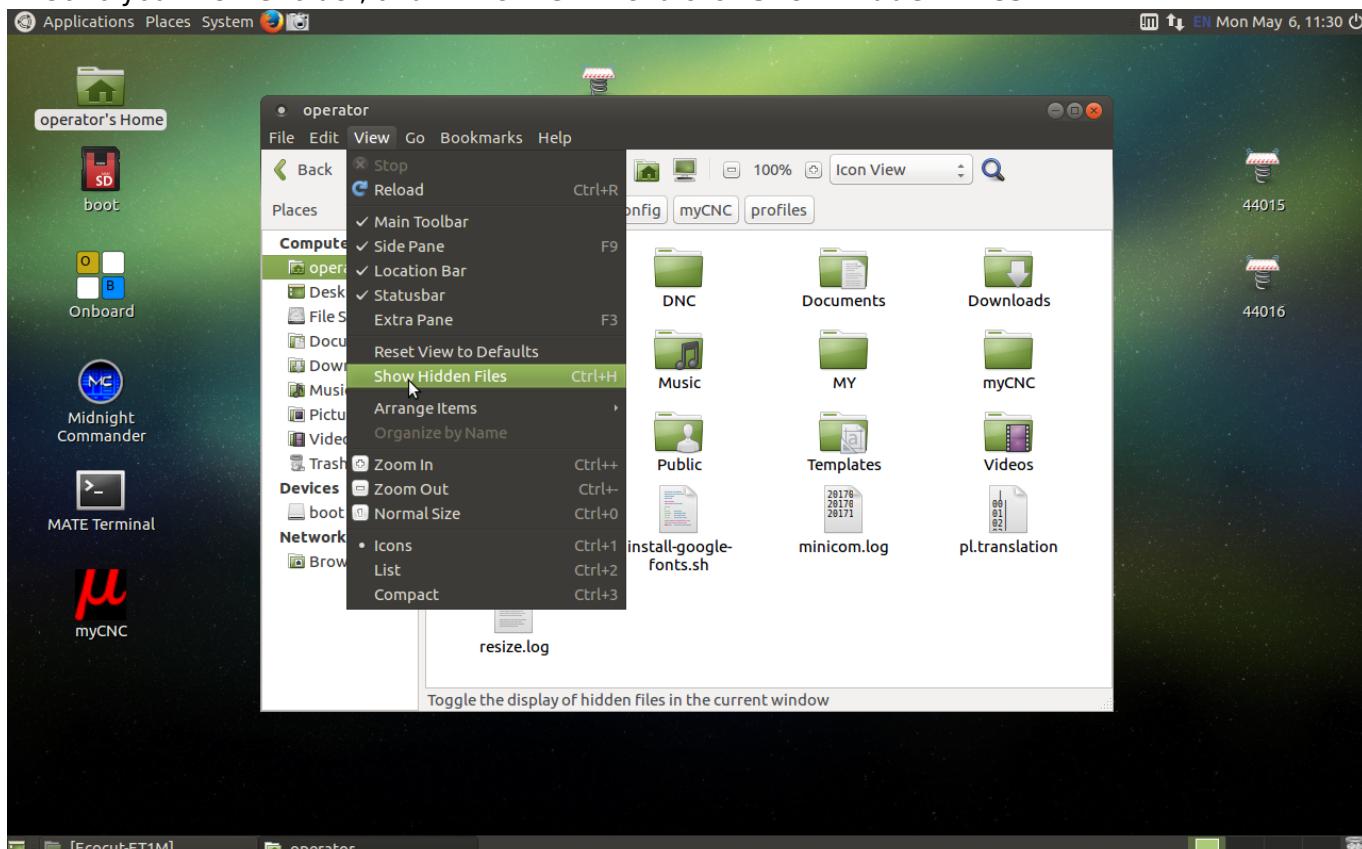


2. From your Home folder, navigate to .config > myCNC > profiles, and create folders named **1** and **2**

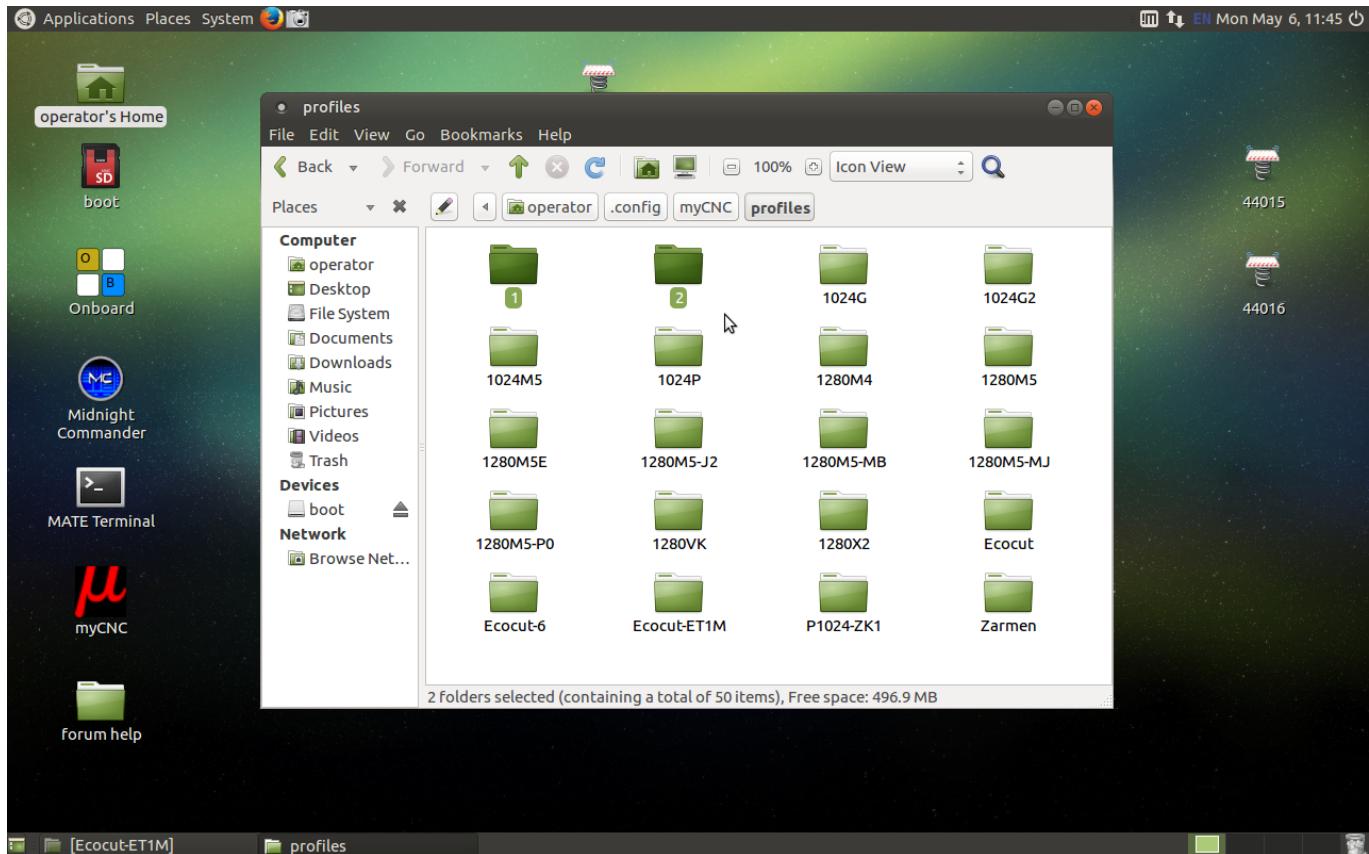


3. Copy the contents of another profile folder (for example, the contents of .config/myCNC/profiles/12805) into both new folders. Here, you can choose which profiles you usually use on your machine.

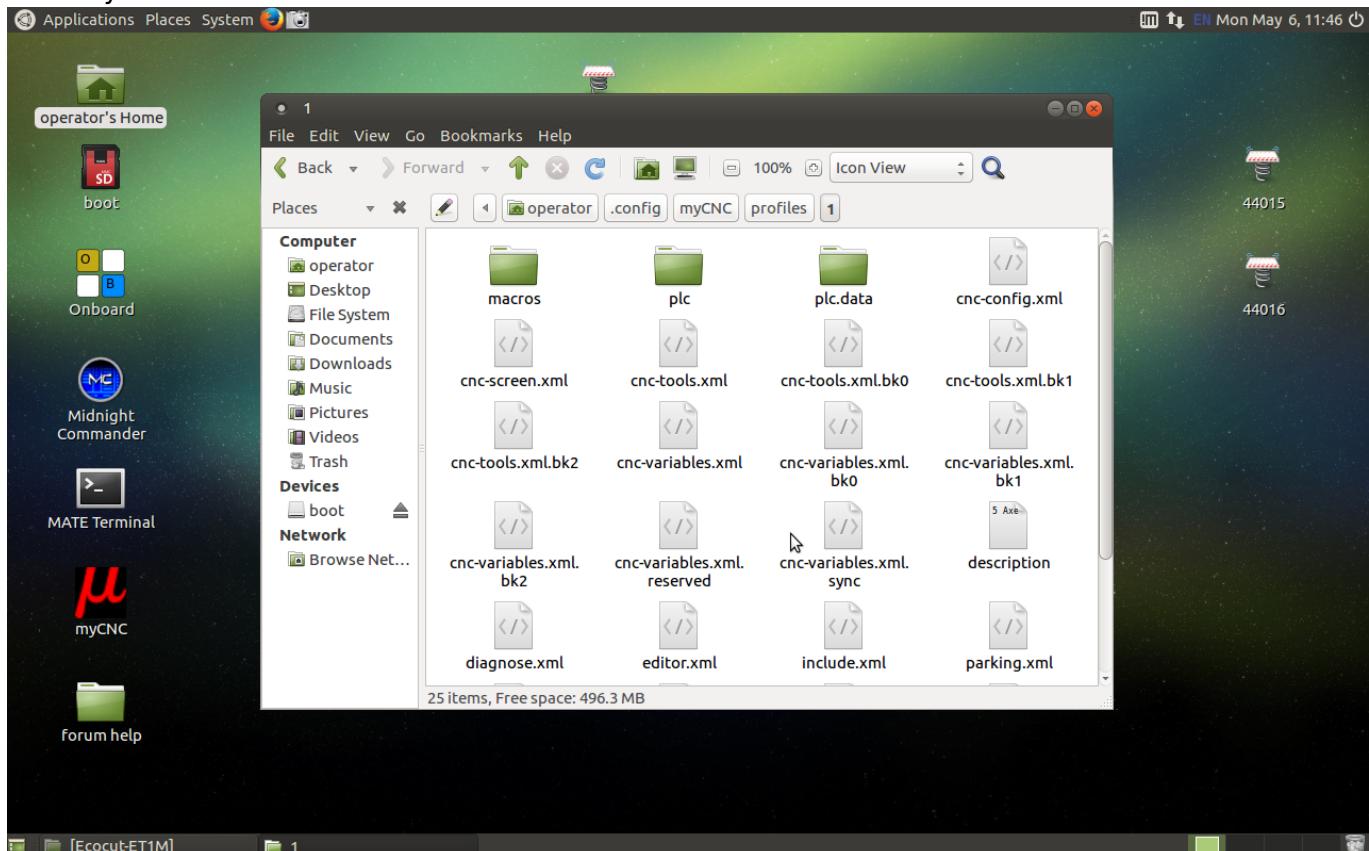

4. Go back to your home folder, and from there navigate to the **myCNC** folder (NOTE: this is a different folder from before, so go Home > myCNC instead of Home > .config > myCNC).

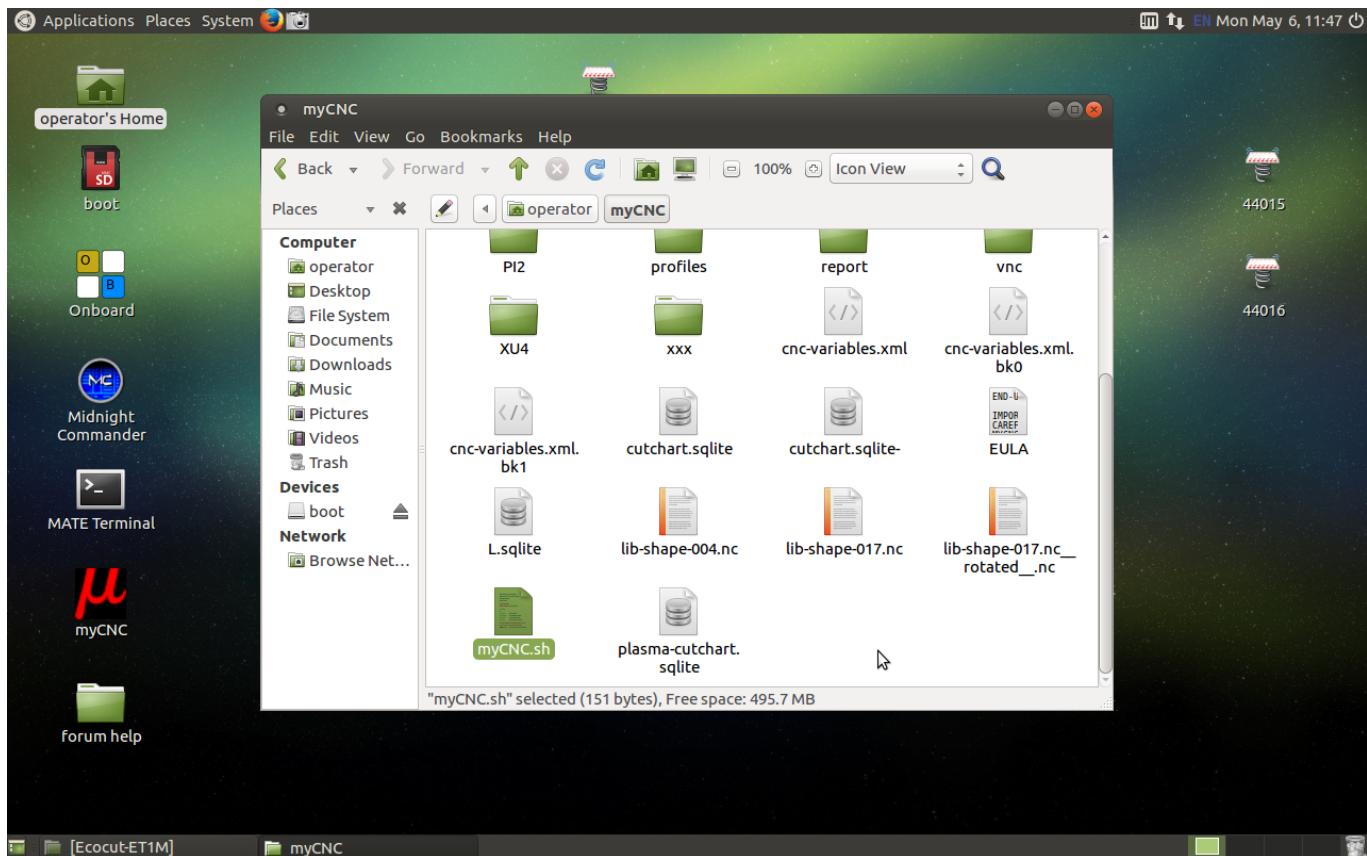

5. Open the **myCNC.sh** file (click Display when asked whether you want to run the file or display its contents).

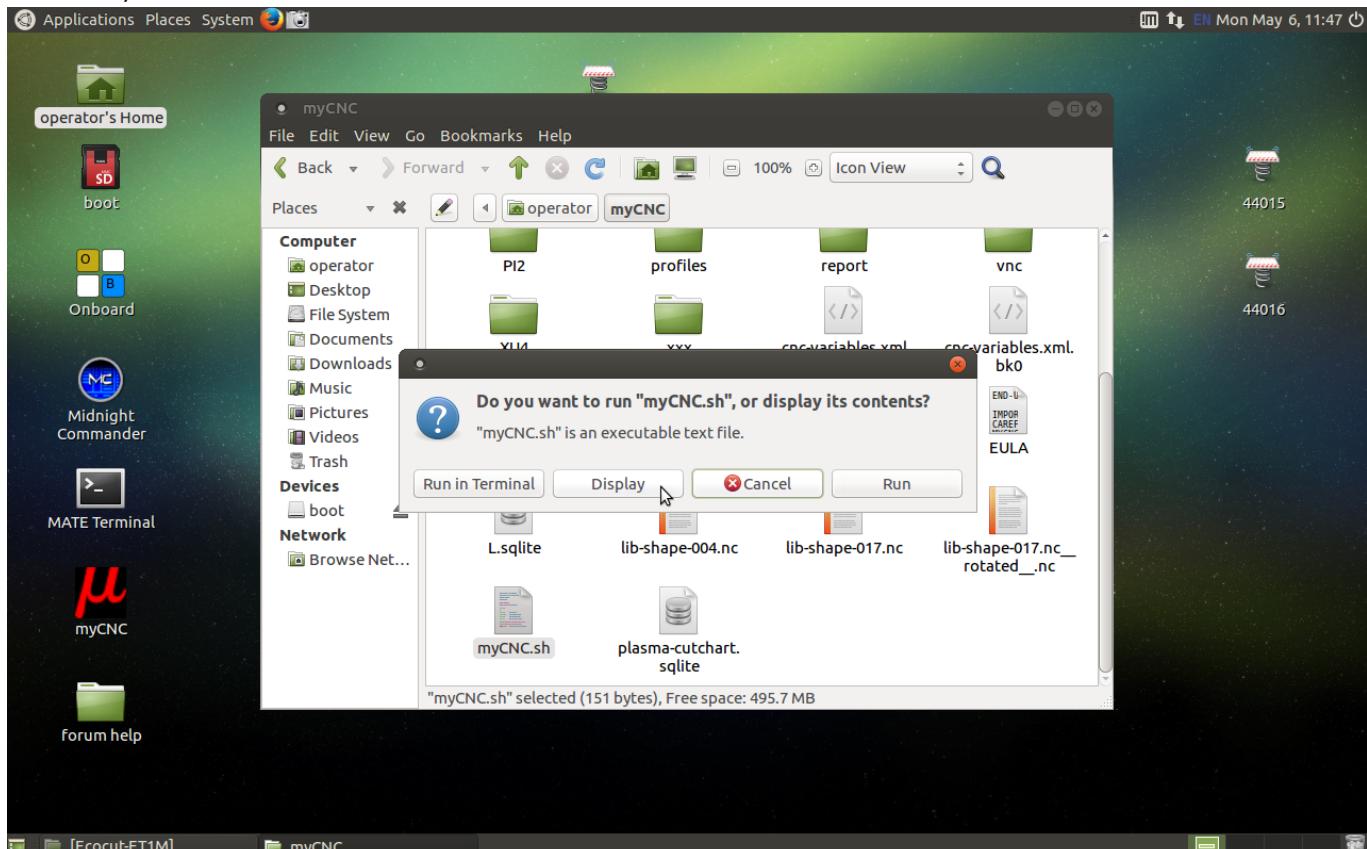

6. Paste the following code into the file, then save it and close the editor.

```
#!/bin/bash
```

```
cd $(dirname $0)
echo DIRNAME: $(dirname $0)


killall myCNC
killall myCNC

xset s 0
xset -dpms

./C2/myCNC -p1 &

./C2/myCNC -p2
```

7. Run the **myCNC.sh** file by selecting Run in Terminal after opening the file. Two instances of myCNC software should now be running.

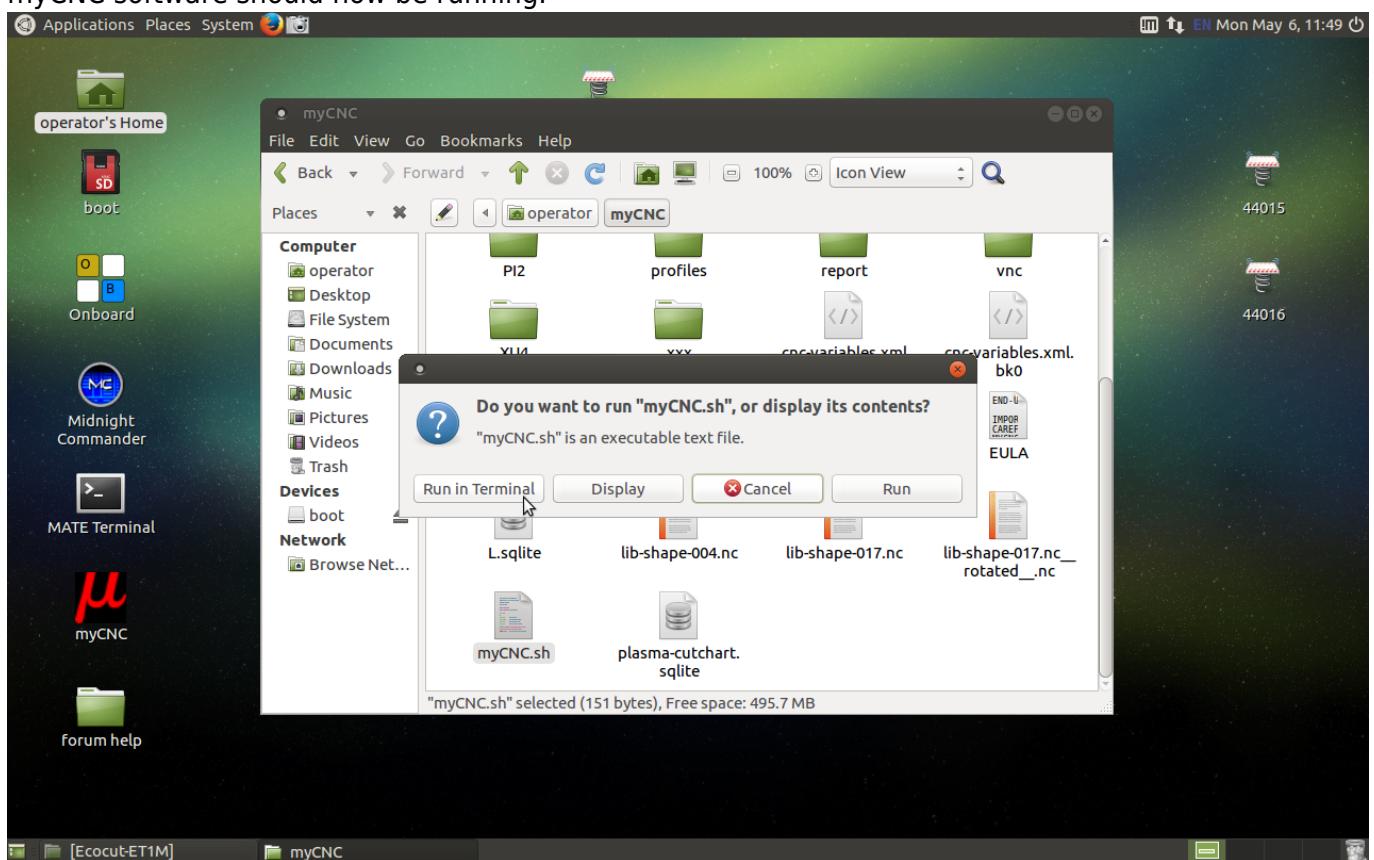

## Setting up a 2-motor X+Y X-Y 3D-printer

A 3D printer shown below is an example of a setup which utilized the X+Y and X-Y axis configuration in Settings → Config → Axes/Motors:

<http://forum.pv-automation.com/download/file.php?id=1135&t=1>  
<http://forum.pv-automation.com/download/file.php?id=1134&t=1>

## Setting up a waterjet system

Certain CAM software packages can automatically insert necessary waterjet M-codes at some desired distance from the corners to properly accelerate and decelerate the machine. These M-codes are **M64/M65**, as well as **M164/M165** - the first two turn a specified output on/off on the fly without stopping (using the special FlyCut license that we provide), while M164/M165 are reserved for controlling the PWM output.

Some profiles within myCNC software (such as X1366P) contain a Software PLC procedure (WATERJET\_SLOWSPED) that works by monitoring the state of the output that the above codes toggle on and off:

```
main()
{
    a0=gvarget(7184)&(1<<10);
do{
    a1=gvarget(7184)&(1<<10);
    if (a0!=a1)
    {
        a0=a1;
        if (a0==0) //normal speed
        {
            gvarset(9379,0);
        }else //slow speed
        {
            gvarset(9379,1);
        };
    };
}while(1);
};
```

The above software PLC monitors the state of the desired output and switches the state of the global variable #9379. Writing “1” to this global variable results in a timer being started in the myCNC system, allowing the software, with the help of “Overspeed %” value, to smoothly reduce/increase the speed while passing a corner.

As mentioned before, this functionality requires a FlyCut license, which is available to purchase on request.

## Connecting a servo drive to a myCNC controller

[Connecting a servo drive to a myCNC controller](#)

From:

[http://www.cnc42.com/ - myCNC Online Documentation](http://www.cnc42.com/)



Permanent link:

[http://www.cnc42.com/mycnc/mycnc\\_setup\\_examples](http://www.cnc42.com/mycnc/mycnc_setup_examples)

Last update: **2024/01/30 12:09**